


OIL ANALYSIS REPORT

AIRLUBE 228 [1402767] Machine Id ATLAS COPCO AIF072-821 - FRAM 6

Component

Compressor

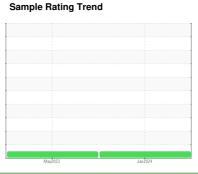



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

CAMPLE INFORM	AATION	ام مالم مما	lineit/lenen		المراجعة والمراجعة	histow.O
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06098521	UCH05910134	
Sample Date		Client Info		10 Jan 2024	24 May 2023	
Machine Age	hrs	Client Info		113257	109300	
Oil Age	hrs	Client Info		2588	5995	
Oil Changed		Client Info		Not Changd	Not Changd	
Sample Status				NORMAL	NORMAL	
CONTAMINATION	N	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	0	
Chromium	ppm	ASTM D5185m	>5	0	0	
Nickel	ppm	ASTM D5185m		<1	0	
Titanium	ppm	ASTM D5185m		0	0	
Silver	ppm	ASTM D5185m		0	0	
Aluminum	ppm	ASTM D5185m	>15	5	0	
Lead	ppm	ASTM D5185m	>65	0	0	
Copper	ppm	ASTM D5185m	>65	0	0	
Tin	ppm	ASTM D5185m	>10	<1	0	
Vanadium	ppm	ASTM D5185m		0	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	1.5	0	0	
Barium	ppm	ASTM D5185m	0	0	0	
Molybdenum	ppm	ASTM D5185m	0	0	0	
Manganese	ppm	ASTM D5185m	0.3	<1	0	
Magnesium	ppm	ASTM D5185m	0	<1	0	
Calcium	ppm	ASTM D5185m	0	<1	0	
Phosphorus	ppm	ASTM D5185m	406	100	60	
Zinc	ppm	ASTM D5185m	0	0	0	
Sulfur	ppm	ASTM D5185m	1283	26	231	
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	<1	0	
Sodium	ppm	ASTM D5185m		<1	0	
Potassium	ppm	ASTM D5185m	>20	<1	<1	
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.463	0.30	0.51	




OIL ANALYSIS REPORT

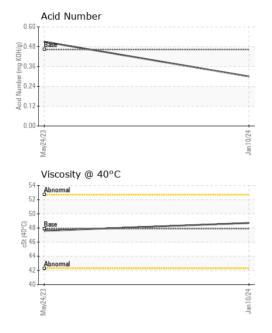





GRAPHS

Bottom

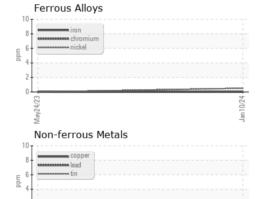

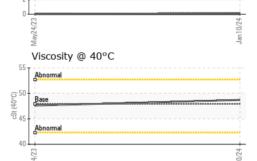

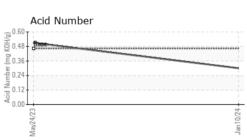





Certificate L2367

Laboratory Sample No.

Lab Number : 06098521 Unique Number: 10896751 Test Package : IND 2

To discuss this sample report, contact Customer Service at 1-800-237-1369.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : UCH06098521 Received **Tested**

Diagnosed

: 26 Feb 2024 : 26 Feb 2024 - Don Baldridge

: 23 Feb 2024

AIR TECHNOLOGIES INC (MID) 400 WRIGHT AVE

MIDDLETOWN, OH US 45044

no image

Contact: KEITH HAYES

Keith.Hayes@aircompressors.com T: (513)615-6378

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (513)539-6040