[W05541]

5460

# **FUEL REPORT**

# Sample Rating Trend







Component Diesel Fuel Fluid DIESEL FUEL No. 1 (--- GAL)

#### DIAGNOSIS

#### Recommendation

All laboratory tests indicate that this sample meets specifications for No.2 ultra-low-sulfur diesel fuel.

#### Corrosion

All metal levels are normal indicating no corrosion in the system.

### Contaminants

The water content is negligible. There is no bacteria or fungus (yeast and/or mold) indicated in the sample. There is no indication of any contamination in the fuel. The amount and size of particulates present in the system are acceptable.

## **Fuel Condition**

Sulfur value derived by ASTM D5453 method for ULSD validation. Sulfur level is acceptable for ULSD specification.


		history2
WC09117	52	
22 Feb 20	)24	
0		
NORMAL		
imit/base curre	nt history1	history2
L2.0		
4 <b>2.3</b>		
imit/base curre	nt history1	history2
0		
8		
imit/base curre	nt history1	history2
.0 <b>0</b> ).1 <b>0</b>		
).1 <b>0</b>		
0.05 <b>0.002</b>		
500 <b>17</b>		
0.50 <b>0.0</b>		
20.0 <b>1.4</b>		
imit/base curre	nt history1	history2
2500 <b>1192</b>		
<b>351</b>		
30 <b>24</b>		
20 <b>4</b>		
0		
8 0		
8/16/13 <b>17/16/1</b>	2	
imit/base curre	nt history1	history2
).1 <b>0</b>		
).1 <b>0</b>		
0.1 <b>O</b>		
).1 <b>0</b>		
imit/base curre	nt history1	history2
	no image	no image
	no image	no image
		no image Contact/Location : 1

Report Id: ATLRIC [WUSCAR] 06100575 (Generated: 03/01/2024 11:59:48) Rev: 1


\_ .



# **FUEL REPORT**

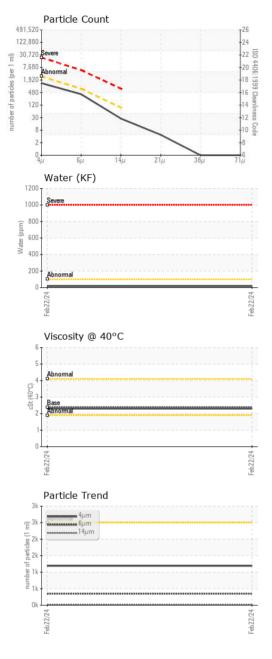

	Pensky-Martens Flash Point (°C)	
	10	
	8	
	6	
	4	
temperature °C	2	
ıperat	0	
terr	-2	
	4	
	-6	
	-8 -	
	10	24
	Feb 22/24	Feb22/24

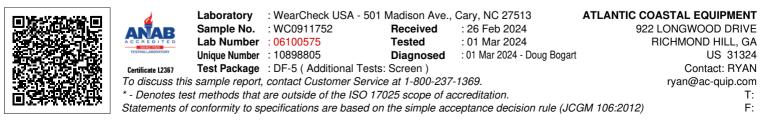

Contact/Location: RYAN ? - ATLRIC

Page 2 of 2