

# FUEL REPORT

Sample Rating Trend

**WATER**



Area  
**[W08010437]**  
 Machine Id  
**VOLVO A45G 352349**  
 Component  
**Diesel Fuel**  
 Fluid  
**{not provided} (--- GAL)**

**DIAGNOSIS**

**▲ Recommendation**

We recommend drain/flush system.

**▲ Contaminants**

Sample consists almost entirely of free water.  
 Water appears to be DEF.

**Fuel Condition**

The fuel is no longer serviceable due to the presence of contaminants.



**SAMPLE INFORMATION**

	method	limit/base	current	history1	history2
Sample Number	Client Info		<b>VCP362199</b>	---	---
Sample Date	Client Info		<b>16 Feb 2024</b>	---	---
Machine Age	hrs	Client Info	<b>3965</b>	---	---
Sample Status			<b>SEVERE</b>	---	---


**CONTAMINANTS**

	method	limit/base	current	history1	history2
Water	%	ASTM D6304 <0.05	<b>▲ 99.0</b>	---	---
ppm Water	ppm	ASTM D6304 <500	<b>▲ 990000</b>	---	---
% Gasoline	%	*In-House <0.50	<b>0.0</b>	---	---
% Biodiesel	%	*In-House <20.0	<b>0.0</b>	---	---

**SAMPLE IMAGES**

	method	limit/base	current	history1	history2
Color				no image	no image
Bottom				no image	no image

**FUEL REPORT**

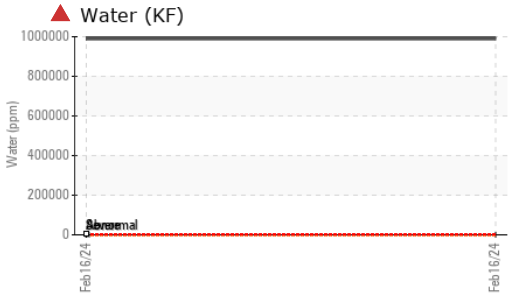

**GRAPHS**



Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : VCP362199  
**Lab Number** : 06101277  
**Unique Number** : 10899507  
**Test Package** : MOB 1 ( Additional Tests: Bacteria, Color-ASTM, GC-PercFuel, KF, PrtCount, XRF)

**Received** : 26 Feb 2024  
**Tested** : 01 Mar 2024  
**Diagnosed** : 01 Mar 2024 - Jonathan Hester

**MCCLUNG-LOGAN EQUIPMENT CO - CHESAPEAKE**  
 4112 HOLLAND BLVD  
 CHESAPEAKE, VA  
 US 23323

To discuss this sample report, contact Customer Service at 1-800-237-1369.

Contact: D BUTLER  
 dbutler@mcclung-logan.com

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:  
 F: (757)485-3415