


Area
PALASYN 45
Machine Id
SULLIVAN PALATEK 23AE003630 - ULTRA PLATING
Component
Compressor

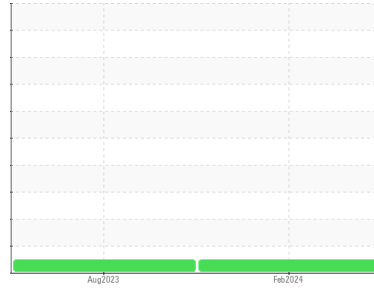

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			UCS06101757	UCS05937321	---
Sample Date	Client Info			16 Feb 2024	21 Aug 2023	---
Machine Age	hrs	Client Info		8881	4589	---
Oil Age	hrs	Client Info		4000	4589	---
Oil Changed	Client Info			Changed	Changed	---
Sample Status				NORMAL	NORMAL	---

CONTAMINATION		method	limit/base	current	history1	history2
Water	WC Method		>0.1	NEG	NEG	---



WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	<1	---
Chromium	ppm	ASTM D5185m	>10	0	<1	---
Nickel	ppm	ASTM D5185m		0	0	---
Titanium	ppm	ASTM D5185m		0	<1	---
Silver	ppm	ASTM D5185m		0	0	---
Aluminum	ppm	ASTM D5185m	>25	0	0	---
Lead	ppm	ASTM D5185m	>25	0	<1	---
Copper	ppm	ASTM D5185m	>50	<1	2	---
Tin	ppm	ASTM D5185m	>15	0	<1	---
Vanadium	ppm	ASTM D5185m		0	<1	---
Cadmium	ppm	ASTM D5185m		0	<1	---

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0.0	0	0	---
Barium	ppm	ASTM D5185m	0.0	0	0	---
Molybdenum	ppm	ASTM D5185m	0	0	0	---
Manganese	ppm	ASTM D5185m	0	0	<1	---
Magnesium	ppm	ASTM D5185m	0.0	0	6	---
Calcium	ppm	ASTM D5185m	0.0	0	3	---
Phosphorus	ppm	ASTM D5185m	966	590	601	---
Zinc	ppm	ASTM D5185m	0	0	13	---
Sulfur	ppm	ASTM D5185m	1309	946	1149	---

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	3	5	---
Sodium	ppm	ASTM D5185m		<1	1	---
Potassium	ppm	ASTM D5185m	>20	0	2	---

FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.172	0.21	0.22	---

OIL ANALYSIS REPORT

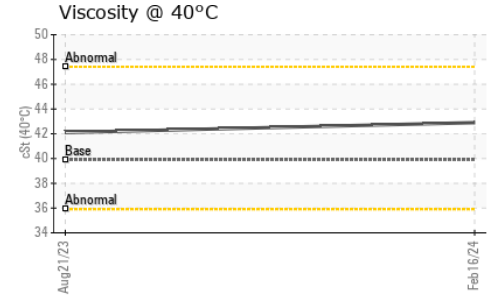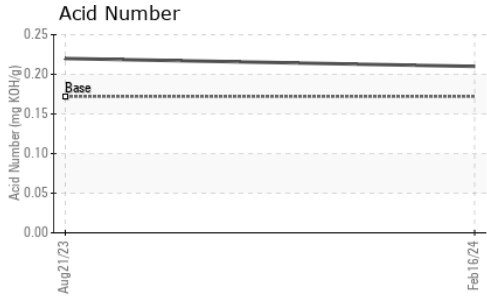





VISUAL	method	limit/base	current	history1	history2	
White Metal	scalar	*Visual	NONE	NONE	NONE	---
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	---
Precipitate	scalar	*Visual	NONE	NONE	NONE	---
Silt	scalar	*Visual	NONE	NONE	NONE	---
Debris	scalar	*Visual	NONE	NONE	NONE	---
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	---
Appearance	scalar	*Visual	NORML	NORML	NORML	---
Odor	scalar	*Visual	NORML	NORML	NORML	---
Emulsified Water	scalar	*Visual	>0.1	NEG	NEG	---
Free Water	scalar	*Visual		NEG	NEG	---

FLUID PROPERTIES	method	limit/base	current	history1	history2	
Visc @ 40°C	cSt	ASTM D445	39.9	42.9	42.1	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

Color					no image
Bottom					no image

GRAPHS

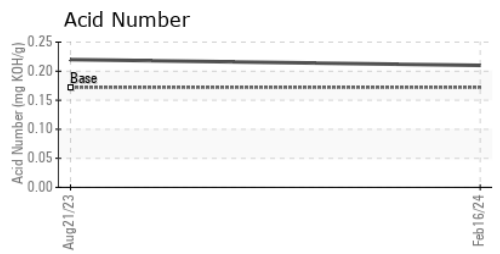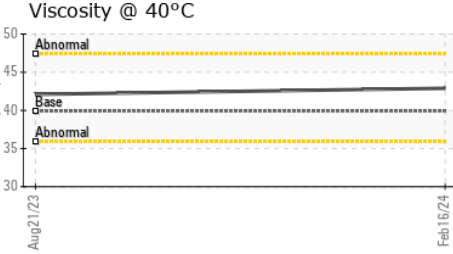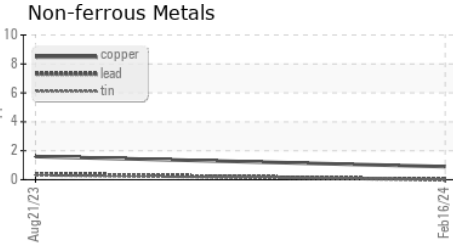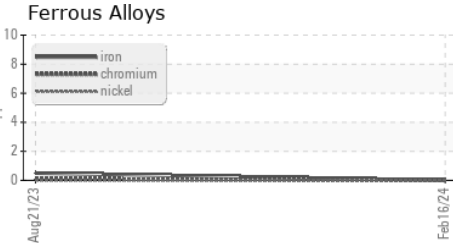

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : UCS06101757 **Received** : 27 Feb 2024
Lab Number : **06101757** **Tested** : 29 Feb 2024
Unique Number : 10899987 **Diagnosed** : 29 Feb 2024 - Don Baldrige
Test Package : IND 2

VACUUM PUMP and COMPRESSOR
 1490 GRUBER RD
 GREEN BAY, WI
 US 54313
 Contact: ROBIN
 robin@vpc-inc.com
 T: (920)662-1113
 F: (920)662-1116

To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)