

OIL ANALYSIS REPORT

Area CAMERON [200004662] Machine Id C-22

Component Hydraulic System Fluid SHELL TELLUS S2 VX 32 (--- LTR)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sample Rating Trend



NORMAL

SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		NX015442		
Sample Date		Client Info		06 Mar 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
PQ		ASTM D8184		12		
Iron	ppm	ASTM D5185m	>20	0		
Chromium	ppm	ASTM D5185m	>20	4		
Nickel	ppm	ASTM D5185m	>20	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>20	0		
Lead	ppm	ASTM D5185m	>20	0		
Copper	ppm	ASTM D5185m	>20	2		
Tin	ppm	ASTM D5185m	>20	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron		ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
	ppm	ASTM D5185m		0		
Molybdenum Manganese	ppm	ASTM D5185m		0 <1		
Magnesium	ppm	ASTM D5185m		18		
Calcium	ppm ppm	ASTM D5185m		10		
Phosphorus		ASTM D5185m		277		
Zinc	ppm	ASTM D5185m		251		
Sulfur	ppm	ASTM D5185m		3870		
	ppm			3070		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	<1		
Sodium	ppm	ASTM D5185m		1		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304	>0.05	0.005		
ppm Water	ppm	ASTM D6304	>500	60		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>20000	1179		
Particles >6µm		ASTM D7647	>2500	222		
Particles >14µm		ASTM D7647	>320	14		
Particles >21µm		ASTM D7647	>80	3		
Particles >38µm		ASTM D7647	>20	0		
Particles >71µm		ASTM D7647	>4	0		
Oil Cleanliness		ISO 4406 (c)	>21/18/15	17/15/11		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2

Acid Number (AN) mg KOH/g

mg KOH/g ASTM D8045


Contact/Location: DEVIN LINEHAN - NORDEX

0.41

Report Id: NORDEX [WUSCAR] 06121573 (Generated: 03/21/2024 09:14:59) Rev: 1



OIL ANALYSIS REPORT

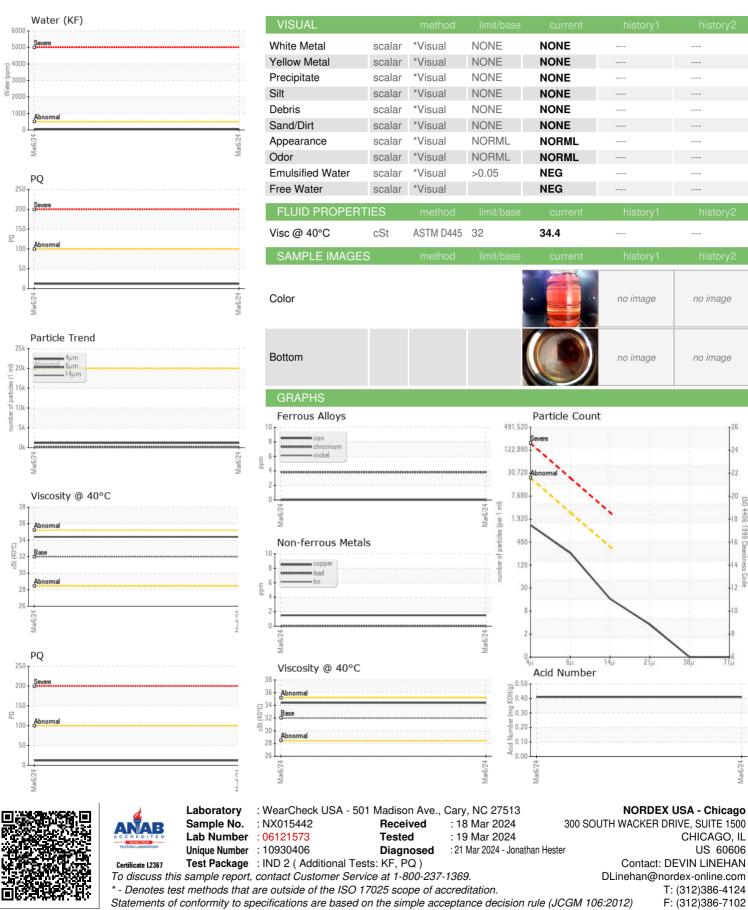

Contact/Location: DEVIN LINEHAN - NORDEX

CHICAGO, IL

US 60606

no image

no image

4406

:1999 Cle

14