

OIL ANALYSIS REPORT

JLG 80SL PL5004 (S/N 1200025004)

Hydraulic System

{not provided} (--- GAL)

DIAGNOSIS

Recommendation

Check seals and/or filters for points of contaminant entry. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We recommend you service the filters on this component. Resample in 30-45 days to monitor this situation. Please specify the brand, type, and viscosity of the oil on your next sample.

Wear

All component wear rates are normal.

▲ Contamination

There is a high amount of silt (particulates < 14 microns in size) present in the oil.

Fluid Condition


The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

Sample Rating	,	ISO
	Mar2024	

				Mar2024		
SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		HPL0004509		
Sample Date		Client Info		13 Mar 2024		
Machine Age	hrs	Client Info		274		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				SEVERE		
CONTAMINATION	I	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	3		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>10	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>10	<1		
Lead	ppm	ASTM D5185m	>10	<1		
Copper	ppm	ASTM D5185m	>75	3		
Tin	ppm	ASTM D5185m	>10	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		106		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		2		
Calcium	ppm	ASTM D5185m		3376		
Phosphorus	ppm	ASTM D5185m		1061		
Zinc	ppm	ASTM D5185m		1319		
Sulfur	ppm	ASTM D5185m		6995		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>20	14		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	0		
FLUID CLEANLIN	ESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	63419		
Particles >6µm		ASTM D7647	>1300	^ 7959		
Particles >14µm		ASTM D7647	>160	252		
Particles >21µm		ASTM D7647	>40	44		
Particles >38µm		ASTM D7647	>10	0		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>19/17/14	23/20/15		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.98		



OIL ANALYSIS REPORT

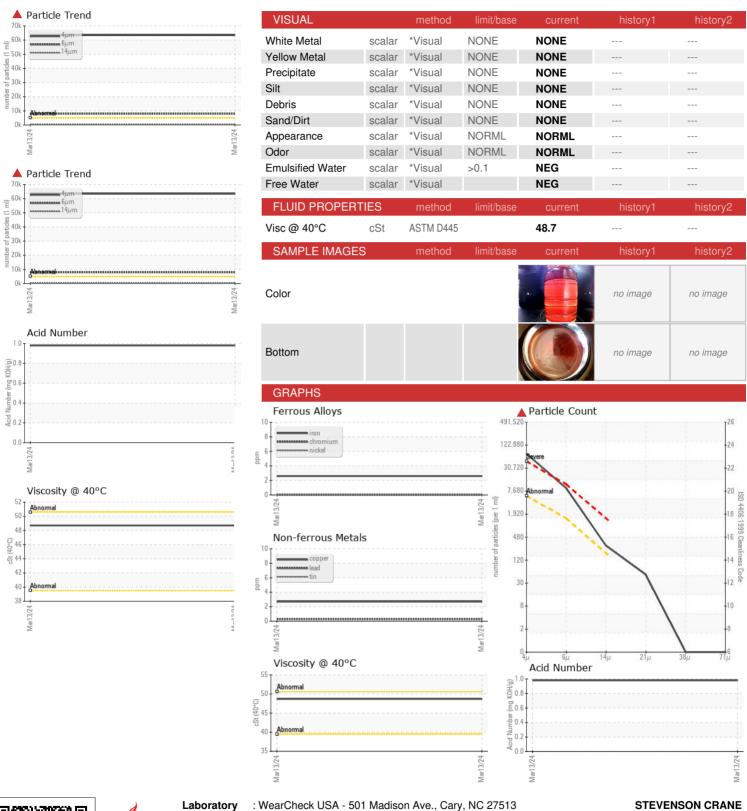





Certificate L2367

Laboratory

Sample No.

: HPL0004509 Lab Number : 06122296 Unique Number : 10936447

Test Package : MOB 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received **Tested**

Diagnosed

: 20 Mar 2024 : 20 Mar 2024 - Wes Davis

: 19 Mar 2024

410 STEVENSON DR BOLINGBROOK, IL US 60440 Contact: DAVE KOEHNE

davidk@stevensoncrane.com T: (630)972-9199

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: