




OIL ANALYSIS REPORT

Sample Rating Trend

NORMAL

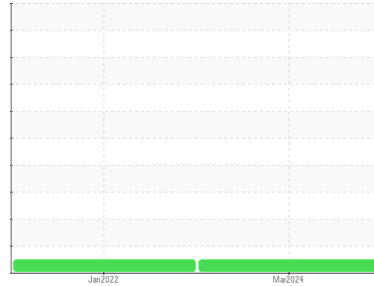

Machine Id
MB8951A

Component
Hydraulic System

Fluid
PHILLIPS 66 Powerflow NZ AW46 (--- QTS)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0891819	WC0653900	---
Sample Date	Client Info		18 Mar 2024	13 Jan 2022	---
Machine Age	hrs	Client Info	0	0	---
Oil Age	hrs	Client Info	0	0	---
Oil Changed	Client Info		N/A	N/A	---
Sample Status			NORMAL	NORMAL	---

CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>0.05	NEG	NEG	---

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >20	7	5	---
Chromium	ppm	ASTM D5185m >20	2	<1	---
Nickel	ppm	ASTM D5185m >20	0	<1	---
Titanium	ppm	ASTM D5185m	<1	0	---
Silver	ppm	ASTM D5185m	0	<1	---
Aluminum	ppm	ASTM D5185m >20	2	<1	---
Lead	ppm	ASTM D5185m >20	0	<1	---
Copper	ppm	ASTM D5185m >20	6	5	---
Tin	ppm	ASTM D5185m >20	<1	<1	---
Vanadium	ppm	ASTM D5185m	0	0	---
Cadmium	ppm	ASTM D5185m	0	0	---

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	<1	---
Barium	ppm	ASTM D5185m	0	<1	---
Molybdenum	ppm	ASTM D5185m	0	0	---
Manganese	ppm	ASTM D5185m	0	0	---
Magnesium	ppm	ASTM D5185m	7	7	---
Calcium	ppm	ASTM D5185m	31	27	---
Phosphorus	ppm	ASTM D5185m	244	250	---
Zinc	ppm	ASTM D5185m	279	291	---
Sulfur	ppm	ASTM D5185m	3489	3918	---

CONTAMINANTS


	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >15	2	<1	---
Sodium	ppm	ASTM D5185m	0	0	---
Potassium	ppm	ASTM D5185m >20	1	0	---

VISUAL





	method	limit/base	current	history1	history2
White Metal	scalar	*Visual NONE	NONE	NONE	---
Yellow Metal	scalar	*Visual NONE	NONE	NONE	---
Precipitate	scalar	*Visual NONE	NONE	NONE	---
Silt	scalar	*Visual NONE	NONE	NONE	---
Debris	scalar	*Visual NONE	NONE	NONE	---
Sand/Dirt	scalar	*Visual NONE	NONE	NONE	---
Appearance	scalar	*Visual NORML	NORML	NORML	---
Odor	scalar	*Visual NORML	NORML	NORML	---
Emulsified Water	scalar	*Visual >0.05	NEG	NEG	---
Free Water	scalar	*Visual	NEG	NEG	---

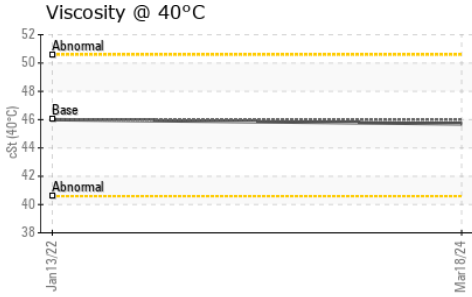




OIL ANALYSIS REPORT



FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445 46	45.7	46.0	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color					no image
Bottom					no image

GRAPHS

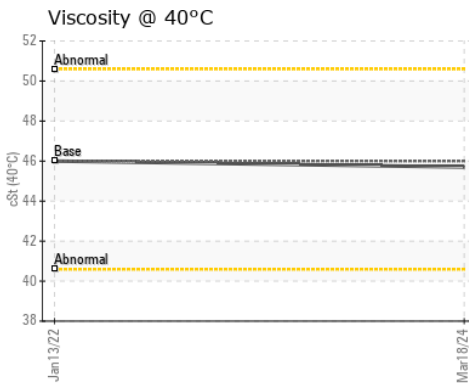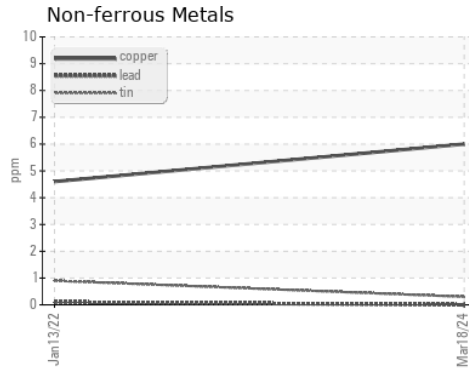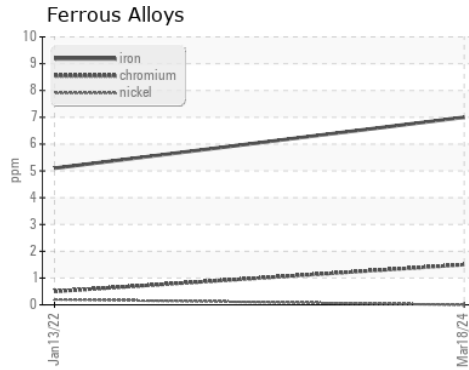

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0891819 **Received** : 19 Mar 2024
Lab Number : 06122797 **Tested** : 20 Mar 2024
Unique Number : 10936948 **Diagnosed** : 21 Mar 2024 - Don Baldrige
Test Package : IND 1

SUMIRIKO TENNESSEE INC
 150 HESTER LN
 TAZEWELL, TN
 US 37879
 Contact: JEREMY COLLINS
 jcollins@us.sumiriko.com
 T: (423)626-8805
 F: (423)626-2065

To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)