

# **OIL ANALYSIS REPORT**

# BREAK IN OIL **HODGE 2303010829**

Component

Compressor

{not provided} (--- GAL)

# Sample Rating Trend



# Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

# Contamination

There is no indication of any contamination in the


# **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UHC0001066		
Sample Date		Client Info		15 Mar 2024		
Machine Age	hrs	Client Info		424		
Oil Age	hrs	Client Info		424		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINATION	V	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	4		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	<1		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	0		
Tin	ppm	ASTM D5185m	>15	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		420		
Zinc	ppm	ASTM D5185m		12		
Sulfur	ppm	ASTM D5185m		614		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	4		
Sodium	ppm	ASTM D5185m		4		
Potassium	ppm	ASTM D5185m	>20	0		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.18		



# **OIL ANALYSIS REPORT**

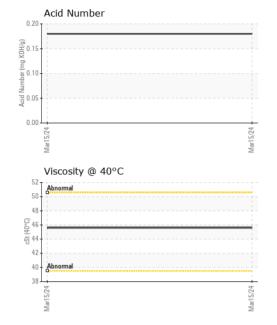



VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
<b>Emulsified Water</b>	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPERT	TIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445		45.6		


CHINI EL IMPIGEO			
Color		no image	no image
Bottom		no image	no image
CDADUS			

# Ferrous Alloys



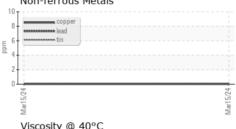

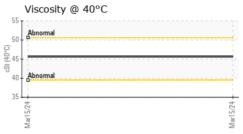

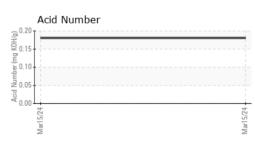





Laboratory Sample No.

: UHC0001066 Lab Number : 06123749 Unique Number : 10937900 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 20 Mar 2024 : 21 Mar 2024 **Tested** 

> Diagnosed : 22 Mar 2024 - Don Baldridge

ATLANTA AIR COMPRESSOR 123 MERCHANTS PARK DR

HOSCHTON, GA US 30548

Contact: Derik Bray Derik@atlantaaircompressor.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: (470)252-9952 F: x:

Report Id: UCATLHOS [WUSCAR] 06123749 (Generated: 03/22/2024 23:47:57) Rev: 1

Contact/Location: Derik Bray - UCATLHOS