


OIL ANALYSIS REPORT

SSR ULTRA COOLANT Machine Id INGERSOLL RAND V2878U16132 - TERMINAL RAILROAD

Component

Compressor

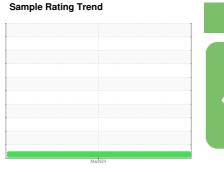



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


				Mar2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06123798		
Sample Date		Client Info		07 Mar 2024		
Machine Age	hrs	Client Info		27605		
Oil Age	hrs	Client Info		7310		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
CONTAMINATION	٧	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	<1		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	0		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	0		
Tin	ppm	ASTM D5185m	>15	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	500	474		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	0	0		
Calcium	ppm	ASTM D5185m	0	0		
Phosphorus	ppm	ASTM D5185m	20	0		
Zinc	ppm	ASTM D5185m	0	2		
Sulfur	ppm	ASTM D5185m	200	333		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		27		
Potassium	ppm	ASTM D5185m	>20	3		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
	1/011:	4.0T1.4.D.00.:-				

Acid Number (AN) mg KOH/g ASTM D8045

0.340



OIL ANALYSIS REPORT

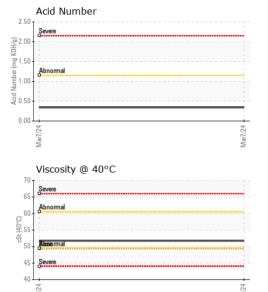

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
ELLID DDODEDT	TIEC	mathad	limit/bass	ourront.	hiotomit	hiotomy


FLUID PROPER	HES	method	ilmit/base		nistory i	nistory2
Visc @ 40°C	cSt	ASTM D445	49.4	51.7		

Color	no image	no image
Bottom	no image	no image

SAMPLE IMAGES



10 T :	errou	5 1	iet	aıs														
8-	coppe	r																
E 6 -	••• tin	<u></u>																
4																		
2					 	-	-	 -	-	_	-	-	-	 	 -	-	-	
Mar7/24																		Mar7/24

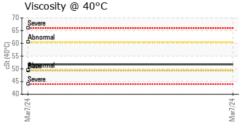



Contact/Location: RACHEL VON HATTEN - UCJOHSAI





Certificate L2367

Laboratory Sample No.

Test Package : IND 2

: UCH06123798 Lab Number : 06123798 Unique Number : 10937949

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received

Tested Diagnosed

: 20 Mar 2024 : 21 Mar 2024

: 22 Mar 2024 - Don Baldridge

JOHN HENRY FOSTER COMPANY

4700 LEBOURGET STREET SAINT LOUIS, MO

US 63134

Contact: RACHEL VON HATTEN rvonhatten@jhf.com

T: (314)593-1267 F: (314)874-0965

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)