

OIL ANALYSIS REPORT

NORMAL





VOLVO A45G 342403

Component 2 Axle

{not provided} (--- GAL)

Recommendation

Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample. (Customer Sample Comment: Flushed axle out with new oil had a previous bad sample)

Wear


All component wear rates are normal.

Contamination

There is no indication of any contamination in the

Fluid Condition


The condition of the oil is acceptable for the time in service.

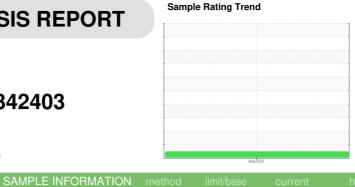


					,	,
Sample Number		Client Info		ML0000808		
Sample Date		Client Info		19 Mar 2024		
Machine Age	hrs	Client Info		8122		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINATION	٧	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>900	60		
Chromium	ppm	ASTM D5185m	>20	0		
Nickel	ppm	ASTM D5185m	>10	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>30	0		
Lead	ppm	ASTM D5185m	>50	0		
Copper	ppm	ASTM D5185m	>150	1		
Tin	ppm	ASTM D5185m	>20	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		275		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		59		
Phosphorus	ppm	ASTM D5185m		2528		
Zinc	ppm	ASTM D5185m		26		
Sulfur	ppm	ASTM D5185m		33458		
CONTANAINIANITO			11 11 11		11.	111
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	3		
Sodium	ppm	ASTM D5185m	0.0	0		
Potassium	ppm	ASTM D5185m	>20	0		
VISUAL		method	limit/base		history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.2	NEG		
Free Water	scalar	*Visual		NEG		




OIL ANALYSIS REPORT

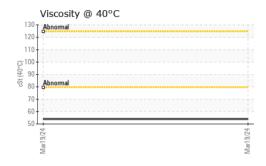



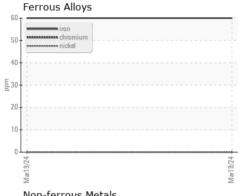

9	copper i		
	** lead		
8	mm tin		
7			
6			
0			
5+			
4			
3			
2			
1 -			
n L		 	
4		 	
Mar19/24			
ia			

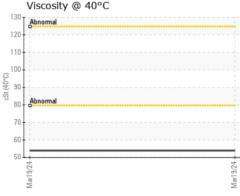



Laboratory Sample No.

: ML0000808 Lab Number : 06124406 Unique Number: 10938557

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 20 Mar 2024 **Tested**

: 21 Mar 2024 Diagnosed : 23 Mar 2024 - Don Baldridge

MCCLUNG-LOGAN EQUIPMENT CO - SALEM 2025 COOK DRIVE SALEM, VA

US 24153 Contact: SCOTT CARR scarr@mcclung-logan.com

T: (540)418-5218

Test Package : CONST Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)