


## **OIL ANALYSIS REPORT**

# ACS-46-5 [417595] **ATLAS COPCO AII168030 - MONDELEZ**

Compressor

Component

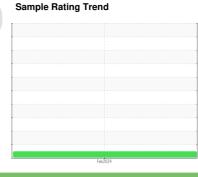



### Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the

### Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


				Feb 2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06125742		
Sample Date		Client Info		28 Feb 2024		
Machine Age	hrs	Client Info		470		
Oil Age	hrs	Client Info		5		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINATION	٧	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>5	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>15	0		
Lead	ppm	ASTM D5185m	>65	0		
Copper	ppm	ASTM D5185m	>65	0		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	1.5	0		
Barium	ppm	ASTM D5185m	0	0		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m	0.3	0		
Magnesium	ppm	ASTM D5185m	0	0		
Calcium	ppm	ASTM D5185m	0	0		
Phosphorus	ppm	ASTM D5185m	406	116		
Zinc	ppm	ASTM D5185m	0	0		
Sulfur	ppm	ASTM D5185m	1283	1314		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	<1		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	0		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2

0.33

Acid Number (AN) mg KOH/g ASTM D8045 0.463



## **OIL ANALYSIS REPORT**

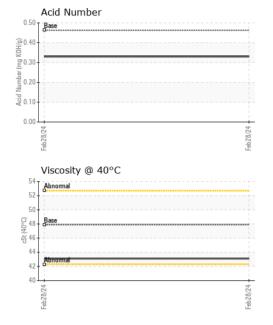


VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
<b>Emulsified Water</b>	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPERTIES		method	limit/base	current	history1	history2

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color				no image	no image
Bottom				no image	no image

43.1

## **GRAPHS**


Visc @ 40°C

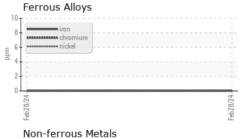


cSt

ASTM D445 47.9



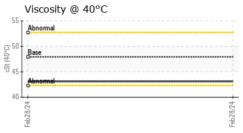

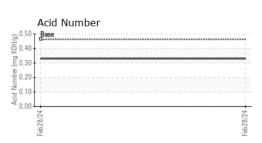





Certificate L2367

Laboratory Sample No. Lab Number : 06125742 Unique Number : 10939893

Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : UCH06125742

Received **Tested** 

: 21 Mar 2024 : 25 Mar 2024 : 25 Mar 2024 - Don Baldridge Diagnosed

**AIRMATIC COMPRESSOR SYSTEMS** 

700 WASHINGTON AVE CARLSTADT, NJ

US 07072 Contact: ELVIN DIAZ

To discuss this sample report, contact Customer Service at 1-800-237-1369.

ediaz@air matic compressor.com; can a stasio@we archeckus a.comT: (800)864-7621

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (201)342-6241

Contact/Location: ELVIN DIAZ - UCAIRCAR