


OIL ANALYSIS REPORT

ROTO XTEND [418304] Machine Id ATLAS COPCO ITJ281750 - NEW YORK SIGN ART

Component

Compressor

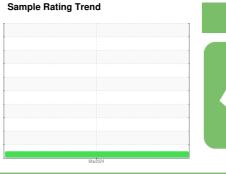



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


				Mar2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06125756		
Sample Date		Client Info		21 Mar 2024		
Machine Age	hrs	Client Info		6615		
Oil Age	hrs	Client Info		1448		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
CONTAMINATION	٧	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>5	0		
Nickel	ppm	ASTM D5185m		<1		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>15	<1		
Lead	ppm	ASTM D5185m	>65	0		
Copper	ppm	ASTM D5185m	>65	<1		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		1		
Calcium	ppm	ASTM D5185m		<1		
Phosphorus	ppm	ASTM D5185m		51		
Zinc	ppm	ASTM D5185m		120		
Sulfur	ppm	ASTM D5185m		146		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	<1		
Sodium	ppm	ASTM D5185m		6		
Potassium	ppm	ASTM D5185m	>20	0		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2

0.22


Acid Number (AN) mg KOH/g ASTM D8045 0.14





OIL ANALYSIS REPORT

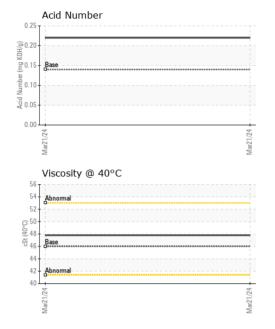



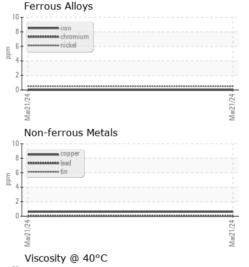

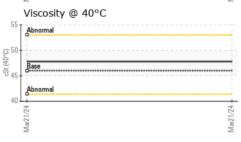

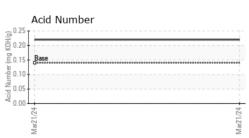



Certificate L2367

Laboratory Sample No. Lab Number : 06125756 Unique Number : 10939907

Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

: UCH06125756

GRAPHS

Received **Tested**

: 21 Mar 2024 : 25 Mar 2024

: 25 Mar 2024 - Don Baldridge Diagnosed

AIRMATIC COMPRESSOR SYSTEMS

700 WASHINGTON AVE CARLSTADT, NJ

> US 07072 Contact: ELVIN DIAZ

To discuss this sample report, contact Customer Service at 1-800-237-1369.

ediaz@airmaticcompressor.com;canastasio@wearcheckusa.com

T: (800)864-7621

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (201)342-6241

Contact/Location: ELVIN DIAZ - UCAIRCAR