


OIL ANALYSIS REPORT

GA-FG [417538] Machine Id ATLAS COPCO ITJ320385

Component

Compressor

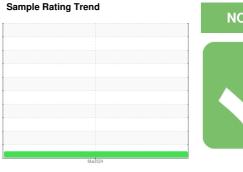



DIAGNOSIS

Recommendation

We suspect abnormal contamination may be due to sampling method. No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a moderate amount of visible silt present in the sample.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


				Mar2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06125773		
Sample Date		Client Info		21 Mar 2024		
Machine Age	hrs	Client Info		3221		
Oil Age	hrs	Client Info		1000		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>5	0		
Nickel	ppm	ASTM D5185m		2		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>15	0		
Lead	ppm	ASTM D5185m	>65	0		
Copper	ppm	ASTM D5185m	>65	0		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		340		
Zinc	ppm	ASTM D5185m		87		
Sulfur	ppm	ASTM D5185m		494		
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	4		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304	>0.1	NEG		
FLUID DEGRADA	NOITA	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.33		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	MODER		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG	ation:-ELVIN DIA	AZ - UCAIRCAF



OIL ANALYSIS REPORT

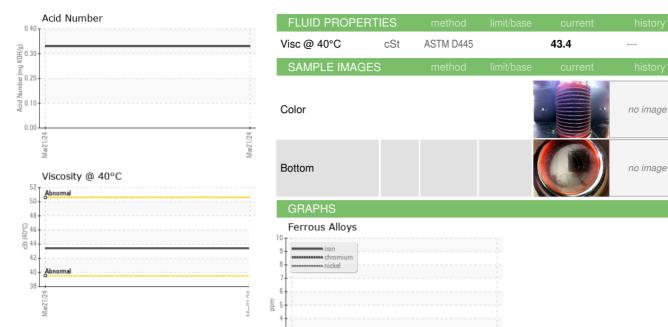

Non-ferrous Metals

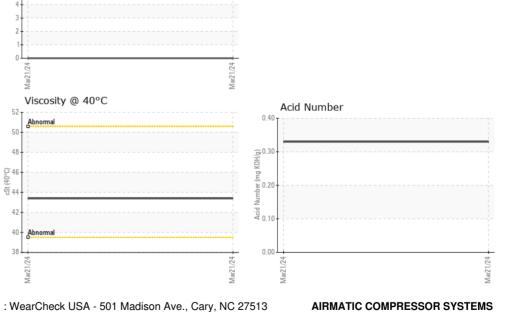



Laboratory Sample No.

Lab Number : 06125773

: UCH06125773

Received **Tested** Unique Number : 10939924

: 21 Mar 2024 Diagnosed

: 26 Mar 2024 : 26 Mar 2024 - Jonathan Hester

AIRMATIC COMPRESSOR SYSTEMS

700 WASHINGTON AVE CARLSTADT, NJ US 07072

no image

no image

Test Package: IND 2 (Additional Tests: KF, PrtCount) Contact: ELVIN DIAZ To discuss this sample report, contact Customer Service at 1-800-237-1369. ediaz@air matic compressor.com; can a stasio@wear check us a.com* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: ELVIN DIAZ - UCAIRCAR

T: (800)864-7621

F: (201)342-6241