


# **OIL ANALYSIS REPORT**

# ROTO XTEND [416926] Machine Id ATLAS COPCO ITJ511125 - US ARMY C515R

Component

Compressor

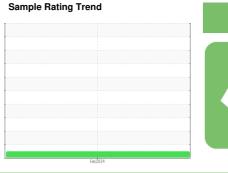



### DIAGNOSIS

## Recommendation

Resample at the next service interval to monitor.

#### Moor

All component wear rates are normal.

## Contamination

There is no indication of any contamination in the oil


# **Fluid Condition**


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


				Feb 2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06125782		
Sample Date		Client Info		12 Feb 2024		
Machine Age	hrs	Client Info		273		
Oil Age	hrs	Client Info		273		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>5	0		
Nickel	ppm	ASTM D5185m		6		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>15	0		
Lead	ppm	ASTM D5185m	>65	0		
Copper	ppm	ASTM D5185m	>65	2		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		2		
Calcium	ppm	ASTM D5185m		2		
Phosphorus	ppm	ASTM D5185m		42		
Zinc	ppm	ASTM D5185m		40		
Sulfur	ppm	ASTM D5185m		179		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	3		
Sodium	ppm	ASTM D5185m		4		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304	>0.1	NEG		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.14	0.117		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG	ation:-ELVIN DIA	AZ - UCAIRCAR





# **OIL ANALYSIS REPORT**

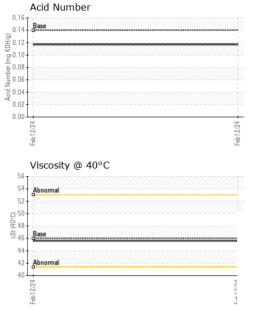


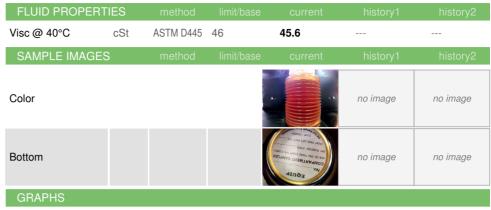

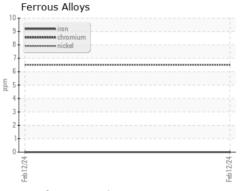

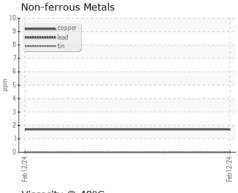

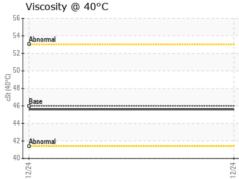

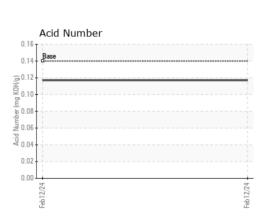



Laboratory Sample No. Lab Number : 06125782

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : UCH06125782

Unique Number: 10939933 Diagnosed

Received : 21 Mar 2024 **Tested** : 26 Mar 2024

: 26 Mar 2024 - Jonathan Hester

**AIRMATIC COMPRESSOR SYSTEMS** 

700 WASHINGTON AVE CARLSTADT, NJ

US 07072 Contact: ELVIN DIAZ

ediaz@air matic compressor.com; can a stasio@we archeckus a.com

T: (800)864-7621 F: (201)342-6241

Test Package: IND 2 (Additional Tests: KF, PrtCount) To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: UCAIRCAR [WUSCAR] 06125782 (Generated: 03/26/2024 19:10:55) Rev: 1

Contact/Location: ELVIN DIAZ - UCAIRCAR