


# **OIL ANALYSIS REPORT**

# DEPT 300 [987945] QUINCY 1 (S/N 10AA026)

Compressor

{not provided} (40 GAL)

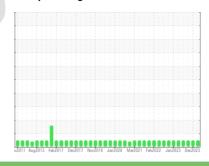

Sample Rating Trend



## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the


### Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0897106	WC0852641	WC0852647
Sample Date		Client Info		21 Mar 2024	28 Dec 2023	06 Oct 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINATION	V	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	0	0
Chromium	ppm	ASTM D5185m	>10	0	0	0
Nickel	ppm	ASTM D5185m		0	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>25	2	3	6
Lead	ppm	ASTM D5185m	>25	0	0	0
Copper	ppm	ASTM D5185m	>50	<1	<1	<1
Tin	ppm	ASTM D5185m	>15	0	0	0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	0	0
Magnesium	ppm	ASTM D5185m		<1	0	0
Calcium	ppm	ASTM D5185m		3	0	0
Phosphorus	ppm	ASTM D5185m		193	180	232
Zinc	ppm	ASTM D5185m		17	23	33
Sulfur	ppm	ASTM D5185m		26	0	39
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1	0	<1
Sodium	ppm	ASTM D5185m		1	2	<1
Potassium	ppm	ASTM D5185m	>20	1	0	0
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.39	0.31	0.37



# **OIL ANALYSIS REPORT**

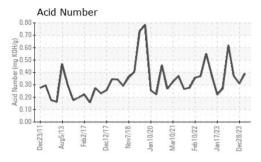

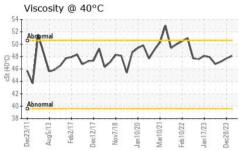

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	LIGHT	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
<b>Emulsified Water</b>	scalar	*Visual	>0.1	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG


TEGID I HOI EITHEG		motriou	IIIIII Dasc	Current	Thistory	1113101 y 2	
Visc @ 40°C	cSt	ASTM D445		48.1	47.7	47.2	


SAMPLE IMAGES


Color


**Bottom** 



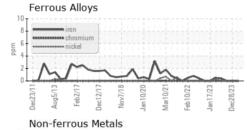





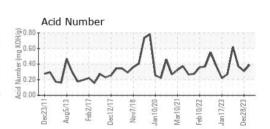





Certificate L2367

Laboratory Sample No.

Test Package : IND 2

Lab Number : 06130775

: WC0897106 Unique Number : 10950240

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received **Tested** 

Diagnosed

: 27 Mar 2024 : 28 Mar 2024

: 01 Apr 2024 - Jonathan Hester

**BALDWIN FILTERS INC** 4400 HIGHWAY 30 EAST KEARNEY, NE US 68847-0724

Contact: JAY FAHRENBRUCH

jay.fahrenbruch@parker.com T:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (800)828-4453