


OIL ANALYSIS REPORT

Sample Rating Trend

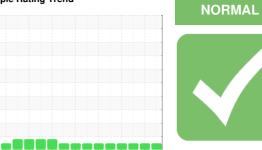

FOS3_U2120 FOS3_U2120_P2120

Drive End Pump

ROYAL PURPLE SYNFILM GT 32 (--- GAL)

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

The water content is negligible. There is no indication of any contamination in the oil.

Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


		Sep2019 Juni	2020 Jan2021 Jul2021	Dec2021 Sep2022 Apr2023	Dec2023	
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		RP0029157	RP0029169	RP0029123
Sample Date		Client Info		22 Mar 2024	18 Dec 2023	14 Jun 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>75	<1	0	0
Chromium	ppm	ASTM D5185m	>5	<1	0	0
Nickel	ppm	ASTM D5185m		0	<1	<1
Titanium	ppm	ASTM D5185m		<1	0	0
Silver	ppm	ASTM D5185m		<1	0	0
Aluminum	ppm	ASTM D5185m	>5	2	<1	<1
Lead	ppm	ASTM D5185m	>10	<1	<1	1
Copper	ppm	ASTM D5185m	>15	<1	<1	<1
Tin	ppm	ASTM D5185m		<1	<1	<1
Vanadium	ppm	ASTM D5185m		<1	0	0
Cadmium	ppm	ASTM D5185m		<1	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		<1	0	0
Manganese	ppm	ASTM D5185m		<1	<1	<1
Magnesium	ppm	ASTM D5185m		93	101	96
Calcium	ppm	ASTM D5185m		8	5	4
Phosphorus	ppm	ASTM D5185m		0	3	3
Zinc	ppm	ASTM D5185m		0	0	0
CONTAMINANTS	5	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>20	2	11	<1
Sodium	ppm	ASTM D5185m		0	<1	1
Potassium	ppm	ASTM D5185m	>20	1	<1	1
Water	%	ASTM D6304	>.1	0.022	0.021	0.019
ppm Water	ppm	ASTM D6304	>1000	224	219	195.7
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.38	0.35	0.42
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	LIGHT	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>.1	NEG	NEG	NEG
Cusa Matau	a a a la v	*\ /:		NEC	Culturalities of Don	EDDIE BIDDI E


NEG Subtracted By: EDDNE GIDDLE




OIL ANALYSIS REPORT

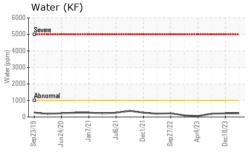


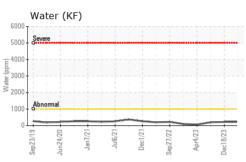


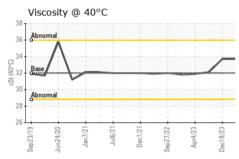




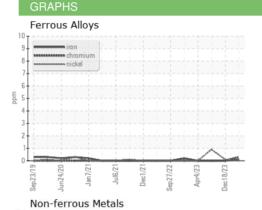

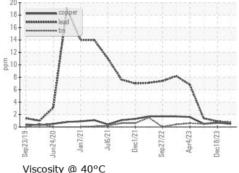

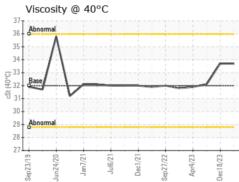

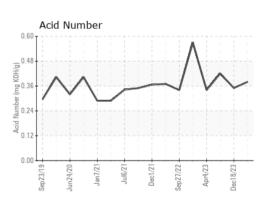





Laboratory Sample No.

: RP0029157

Lab Number : 06131448 Unique Number : 10950913

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 27 Mar 2024 **Tested**

: 01 Apr 2024 Diagnosed

: 01 Apr 2024 - Don Baldridge

ENERGY TRANSFER - FOSTORIA EAST

2196 BRANDEBERRY RD FOSTORIA, OH

US 44830 Contact: EDDIE RIDDLE

Test Package : PLANT Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F:

T: (419)467-7972