


OIL ANALYSIS REPORT

NOT GIVEN Machine Id INGERSOLL RAND PY1072U08269

Component

Compressor

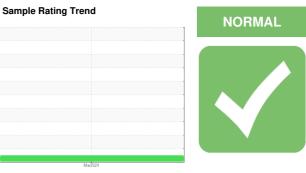

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCS06131459		
Sample Date		Client Info		26 Mar 2024		
Machine Age	hrs	Client Info		39933		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
CONTAMINATIO	N	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	<1		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m		<1		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		<1		
Aluminum	ppm	ASTM D5185m	>25	2		
Lead	ppm	ASTM D5185m	>25	<1		
Copper	ppm	ASTM D5185m	>50	<1		
Tin	ppm	ASTM D5185m	>15	<1		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		<1		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		10		
Molybdenum	ppm	ASTM D5185m		<1		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		3		
Phosphorus	ppm	ASTM D5185m		27		
Zinc	ppm	ASTM D5185m		13		
Sulfur	ppm	ASTM D5185m		59		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	9		
Sodium	ppm	ASTM D5185m		2		
Potassium	ppm	ASTM D5185m	>20	1		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.32		

Sullivan


OIL ANALYSIS REPORT

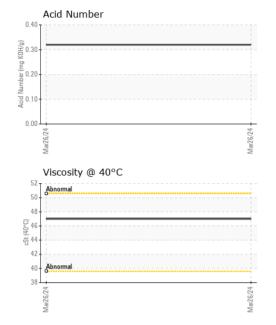


VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPERT	IFS	method	limit/base	current	history1	history2
T LOID T HOT LITT	ILO	memou	IIIIII/Dase	Current	Thistory	HISTOTYZ
Visc @ 40°C	cSt	ASTM D445		47.0		
SAMPLE IMAGES	3	method	limit/base	current	history1	history2


SAMPLE IMAGES	method	limit/base	current	history1	history2
Color		٥		no image	no image
Bottom				no image	no image

GRAPHS

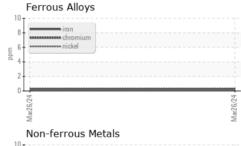



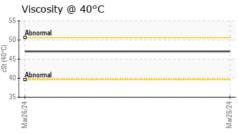

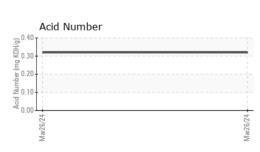





Certificate L2367

Laboratory Sample No.

: UCS06131459 Lab Number : 06131459 Unique Number : 10950924 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 27 Mar 2024 **Tested** : 28 Mar 2024

Diagnosed : 01 Apr 2024 - Don Baldridge

RASMUSSEN AIR & GAS ENERGY

655 240TH STREET WATERLOO, NE

US 68069 Contact: CHASE SVOBODA

chase.svoboda@rage-energy.com

T: (402)614-9926

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: