

OIL ANALYSIS REPORT

ULTRA COOLANT FG [SVO-059767] Machine Id INGERSOLL RAND NV4069U11345 - EVAPCO

Component

Compressor





DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Mar2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06132146		
Sample Date		Client Info		19 Mar 2024		
Machine Age	hrs	Client Info		75102		
Oil Age	hrs	Client Info		2969		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINATION	V	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	3		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	<1		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	6		
Tin	ppm	ASTM D5185m	>15	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		12		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		2		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		42		
Phosphorus	ppm	ASTM D5185m		160		
Zinc	ppm	ASTM D5185m		85		
Sulfur	ppm	ASTM D5185m		401		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		34		
Potassium	ppm	ASTM D5185m	>20	2		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2


Acid Number (AN)

mg KOH/g ASTM D8045

0.78





OIL ANALYSIS REPORT

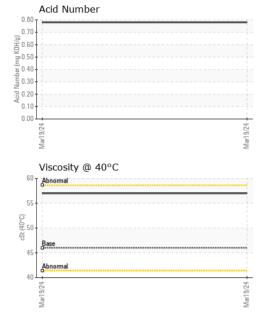



VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPERT	TES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	46.0	57.0		

SAMPLE IMAGES	metnoa	ilmit/base	current	nistory i	nistory2
Color				no image	no image
Bottom				no image	no image
CDADUS					

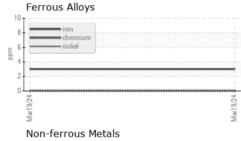

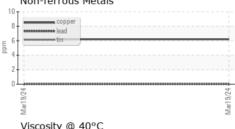

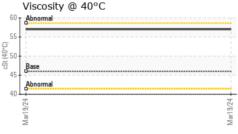

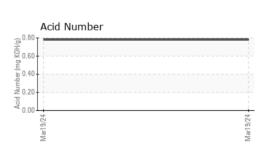





Laboratory Sample No. Unique Number : 10951611

: UCH06132146 Lab Number : 06132146

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received **Tested**

: 29 Mar 2024 Diagnosed : 02 Apr 2024 - Jonathan Hester

: 28 Mar 2024

JOHN HENRY FOSTER COMPANY

4700 LEBOURGET STREET

SAINT LOUIS, MO US 63134

Contact: RACHEL VON HATTEN

rvonhatten@jhf.com T: (314)593-1267

F: (314)874-0965

Contact/Location: RACHEL VON HATTEN - UCJOHSAI

Test Package : IND 2 Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)