

OIL ANALYSIS REPORT

Sample Rating Trend

NORMAL



TO60001122

TOWER 11S (S/N 002145859-1-1)

Component Dialet Coorbo

Right Gearbox

SHELL MORLINA S4 B 220 (18 GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The condition of the oil is acceptable for the time in service.

Sample Number	Client Info		TO60002398	TO600	014
SAMPLE INFORMATION	method	limit/base	current	hi	stor
	May2023	Aug2023	Jan 2024	Mar2024	
) 3-1-1)					
59-1-1)					

Sample Number		Client Into		1060002398	1060001401	1060001122
Sample Date		Client Info		25 Mar 2024	04 Jan 2024	03 Aug 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINATION	١	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
PQ		ASTM D8184		16	12	7
Iron	ppm	ASTM D5185m	>200	2	<1	2
Chromium	ppm	ASTM D5185m	>15	0	0	0
Nickel	ppm	ASTM D5185m	>15	0	0	<1
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	<1
Aluminum	ppm	ASTM D5185m	>25	0	0	0
Lead	ppm	ASTM D5185m	>100	0	0	0
Copper	ppm	ASTM D5185m	>200	0	0	<1
Tin	ppm	ASTM D5185m	>25	0	0	0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	0	0
Magnesium	ppm	ASTM D5185m		0	0	<1
Calcium	ppm	ASTM D5185m		0	0	0
Phosphorus	ppm	ASTM D5185m		304	300	304
Zinc	ppm	ASTM D5185m		0	0	0
Sulfur	ppm	ASTM D5185m		805	645	733
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	3	4	4
Sodium	ppm	ASTM D5185m		0	0	0
Potassium	ppm	ASTM D5185m	>20	0	0	<1
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML

Emulsified Water

*Visual

scalar *Visual

scalar

>0.2

NEG

NEG


NEG

NEG

mittateBy: CLAY OSTERHOUT



OIL ANALYSIS REPORT

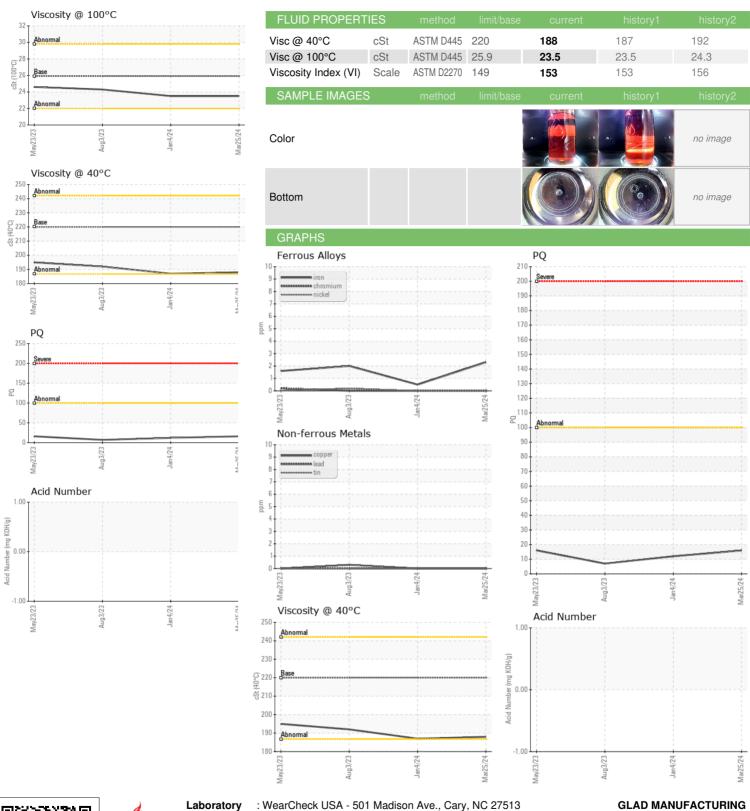





Laboratory Sample No.

Lab Number : 06133654

: TO60002398

Received **Tested** Unique Number: 10953119

Diagnosed Test Package: IND 2 (Additional Tests: KV100, PQ, VI)

: 03 Apr 2024

: 29 Mar 2024

: 03 Apr 2024 - Sean Felton

Contact: CLAY OSTERHOUT clay.osterhout@clorox.com T:

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

1700 N 13TH ST

ROGERS, AR

US 72756

F: