


OIL ANALYSIS REPORT

Sample Rating Trend



NORMAL

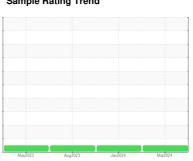

TOWER 3S (S/N 3300)

Component

Center Gearbox

SHELL MORLINA S4 B 220 (50 GAL)

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the

Fluid Condition

The condition of the oil is acceptable for the time in service.

SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		TO60002429	TO60001390	TO60001109
Sample Date		Client Info		25 Mar 2024	04 Jan 2024	03 Aug 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINATION		method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
PQ		ASTM D8184		23	12	14
Iron	ppm	ASTM D5185m	>200	37	0	0
Chromium	ppm	ASTM D5185m	>15	0	0	0
Nickel	ppm	ASTM D5185m	>15	0	0	0
Titanium	ppm	ASTM D5185m		0	0	<1
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>25	0	0	0
Lead	ppm	ASTM D5185m	>100	0	0	0
Copper	ppm	ASTM D5185m	>200	0	0	1
Tin	ppm	ASTM D5185m	>25	0	<1	0
Vanadium	ppm	ASTM D5185m		0	0	<1
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	3	1
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	0	0
Magnesium	ppm	ASTM D5185m		0	0	3
Calcium	ppm	ASTM D5185m		0	0	0
Phosphorus	ppm	ASTM D5185m		301	296	280
Zinc	ppm	ASTM D5185m		0	0	4
Sulfur	ppm	ASTM D5185m		739	757	951
CONTAMINANTS	5	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	3	8	7
Sodium	ppm	ASTM D5185m		<1	0	<1
Potassium	ppm	ASTM D5185m	>20	0	0	4
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
0:14		*\ /'	NONE	HOUSE	NIONIE	NIONIE

NONE

NONE

NONE

NORML

NORML

NEG

NEG

NONE

NONE

NONE

NORML

NORML

NEG

NONE

NONE

NONE

NORML

NORML

>0.2

Silt

Debris

Odor

Sand/Dirt

Appearance

Emulsified Water

scalar *Visual

scalar *Visual

scalar *Visual

scalar *Visual

*Visual

*Visual

*Visual

scalar

scalar

scalar

NONE

NONE

NORML

NORML


NEG

mitted By: CLAY OSTERHOUT

NONE



OIL ANALYSIS REPORT

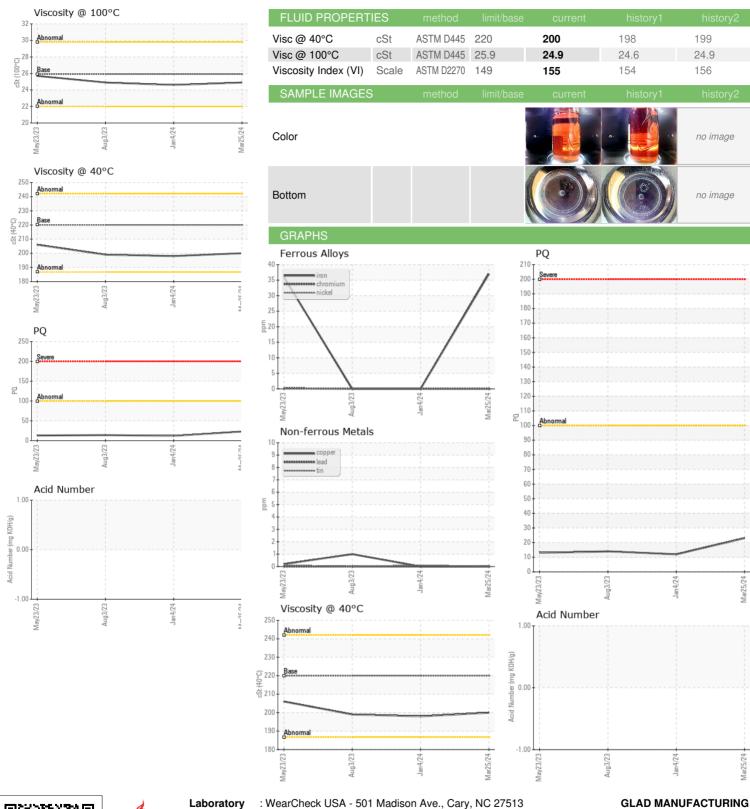





Laboratory Sample No.

Lab Number : 06133661

: TO60002429 Unique Number: 10953126

Received **Tested** Diagnosed

Test Package: IND 2 (Additional Tests: KV100, PQ, VI)

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

: 03 Apr 2024 : 03 Apr 2024 - Sean Felton

: 29 Mar 2024

Contact: CLAY OSTERHOUT

clay.osterhout@clorox.com

T: F:

1700 N 13TH ST

ROGERS, AR

US 72756

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)