

### FUEL REPORT

Sample Rating Trend

# NORMAL

# TAKEUCHI TL12V2 412002317 - FILTER

Component Diesel Fuel

#### Fluid No.2 DIESEL FUEL (ULTRALOW SULPHUR) (--- GAL)

#### DIAGNOSIS

#### Recommendation

This is a baseline read-out on the submitted sample. No corrective action is recommended at this time.

#### Corrosion


All metal levels are normal indicating no corrosion in the system.

#### Contaminants

The water content is negligible. There is no indication of any contamination in the fuel.

#### **Fuel Condition**

The condition of the fuel is acceptable for the time in service.

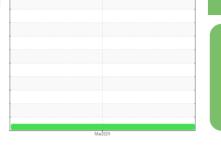






SAMPLE INFORM	1ATION	method	limit/base	current	history1	history2
Sample Number		Client Info		ML0000356		
Sample Date		Client Info		27 Mar 2024		
Machine Age	hrs	Client Info		0		
Sample Status				NORMAL		
PHYSICAL PROP	ERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	3.0	2.3		
SULFUR CONTER	NT	method	limit/base	current	history1	history2
Sulfur	ppm	ASTM D5185m	10	0		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	<1.0	<1		
Sodium	ppm	ASTM D5185m	<0.1	0		
Potassium	ppm	ASTM D5185m	<0.1	1		
Water	%	ASTM D6304	<0.05	0.002		
ppm Water	ppm	ASTM D6304	<500	20		
HEAVY METALS		method	limit/base	current	history1	history2
Aluminum	ppm	ASTM D5185m	<0.1	2		
Nickel	ppm	ASTM D5185m	<0.1	0		
Lead	ppm	ASTM D5185m	<0.1	0		
Vanadium	ppm	ASTM D5185m	<0.1	0		
Iron	ppm	ASTM D5185m	<0.1	0		
Calcium	ppm	ASTM D5185m		3		
Magnesium	ppm	ASTM D5185m	<0.1	<1		
Phosphorus	ppm	ASTM D5185m	<0.1	0		
Zinc	ppm	ASTM D5185m	<0.1	0		
SAMPLE IMAGES	3	method	limit/base	current	history1	history2
Color					no image	no image
Bottom					no image	no image



## **FUEL REPORT**

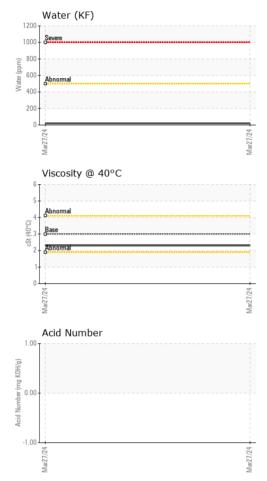

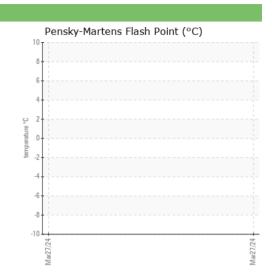

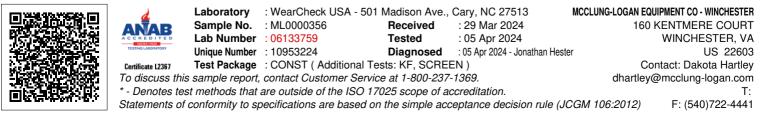

Contact/Location: Service - Dakota Hartley - VOLVO4589