




OIL ANALYSIS REPORT

Sample Rating Trend

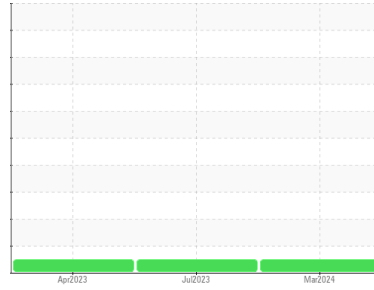

NORMAL



Area
VACUUM PUMP
 Machine Id
B72429 TOP ROTARY VANE PUMP
 Component
Vacuum Pump
 Fluid
BUSCH R530S (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

| SAMPLE INFORMATION | | method | limit/base | current | history1 | history2 |
|--------------------|-------------|-------------|------------|--------------------|-------------|-------------|
| Sample Number | Client Info | | | WC0872482 | WC0781482 | WC0774969 |
| Sample Date | Client Info | | | 11 Mar 2024 | 03 Jul 2023 | 20 Apr 2023 |
| Machine Age | hrs | Client Info | | 0 | 0 | 0 |
| Oil Age | hrs | Client Info | | 0 | 0 | 0 |
| Oil Changed | Client Info | | | Not Changed | Not Changed | Not Changed |
| Sample Status | | | | NORMAL | NORMAL | NORMAL |

| CONTAMINATION | | method | limit/base | current | history1 | history2 |
|---------------|-----------|--------|------------|------------|----------|----------|
| Water | WC Method | | >.1 | NEG | NEG | NEG |

| WEAR METALS | | method | limit/base | current | history1 | history2 |
|-------------|-----|-------------|------------|--------------|----------|----------|
| Iron | ppm | ASTM D5185m | >20 | 4 | 1 | 0 |
| Chromium | ppm | ASTM D5185m | >20 | 0 | 0 | 0 |
| Nickel | ppm | ASTM D5185m | >20 | 0 | 0 | 0 |
| Titanium | ppm | ASTM D5185m | | 0 | 0 | 0 |
| Silver | ppm | ASTM D5185m | | 0 | 0 | 0 |
| Aluminum | ppm | ASTM D5185m | >20 | 0 | 1 | <1 |
| Lead | ppm | ASTM D5185m | >20 | 0 | <1 | 0 |
| Copper | ppm | ASTM D5185m | >20 | 0 | 0 | 0 |
| Tin | ppm | ASTM D5185m | >20 | 0 | <1 | 0 |
| Vanadium | ppm | ASTM D5185m | | <1 | 0 | 0 |
| Cadmium | ppm | ASTM D5185m | | 0 | 0 | 0 |

| ADDITIVES | | method | limit/base | current | history1 | history2 |
|------------|-----|-------------|------------|-------------|----------|----------|
| Boron | ppm | ASTM D5185m | | 0 | 0 | 0 |
| Barium | ppm | ASTM D5185m | | 2 | 0 | 0 |
| Molybdenum | ppm | ASTM D5185m | | 0 | 0 | 0 |
| Manganese | ppm | ASTM D5185m | | 0 | <1 | <1 |
| Magnesium | ppm | ASTM D5185m | | 0 | 0 | 0 |
| Calcium | ppm | ASTM D5185m | | 0 | 0 | 0 |
| Phosphorus | ppm | ASTM D5185m | | 0 | 4 | 3 |
| Zinc | ppm | ASTM D5185m | | 0 | 0 | 0 |
| Sulfur | ppm | ASTM D5185m | | 3689 | 4067 | 2581 |





| CONTAMINANTS | | method | limit/base | current | history1 | history2 |
|--------------|-----|-------------|------------|----------|----------|----------|
| Silicon | ppm | ASTM D5185m | >15 | 3 | 4 | 4 |
| Sodium | ppm | ASTM D5185m | | 5 | <1 | <1 |
| Potassium | ppm | ASTM D5185m | >20 | 3 | 2 | 0 |

| FLUID CLEANLINESS | | method | limit/base | current | history1 | history2 |
|-------------------|--|--------------|------------|-----------------|----------|----------|
| Particles >4µm | | ASTM D7647 | >5000 | 2672 | 1865 | 1901 |
| Particles >6µm | | ASTM D7647 | >1300 | 480 | 524 | 590 |
| Particles >14µm | | ASTM D7647 | >160 | 17 | 20 | 36 |
| Particles >21µm | | ASTM D7647 | >40 | 7 | 3 | 6 |
| Particles >38µm | | ASTM D7647 | >10 | 0 | 0 | 0 |
| Particles >71µm | | ASTM D7647 | >3 | 0 | 0 | 0 |
| Oil Cleanliness | | ISO 4406 (c) | >19/17/14 | 19/16/11 | 18/16/11 | 18/16/12 |

| FLUID DEGRADATION | | method | limit/base | current | history1 | history2 |
|-------------------|----------|------------|------------|-------------|----------|----------|
| Acid Number (AN) | mg KOH/g | ASTM D8045 | | 0.13 | 0.045 | 0.094 |




OIL ANALYSIS REPORT

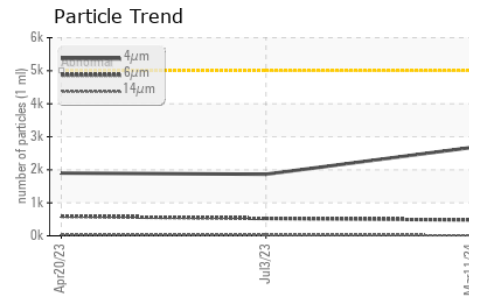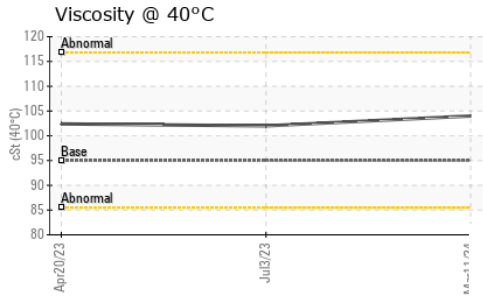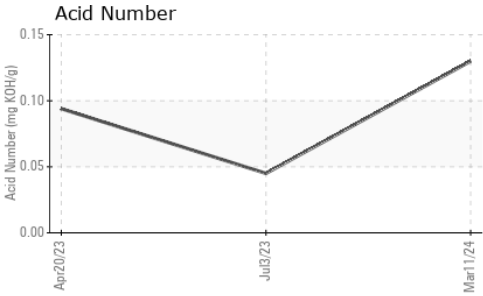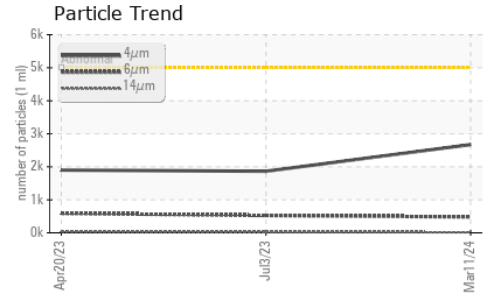






| VISUAL | method | limit/base | current | history1 | history2 |
|------------------|--------|------------|---------|----------|----------|
| White Metal | scalar | *Visual | NONE | NONE | NONE |
| Yellow Metal | scalar | *Visual | NONE | NONE | NONE |
| Precipitate | scalar | *Visual | NONE | NONE | NONE |
| Silt | scalar | *Visual | NONE | NONE | NONE |
| Debris | scalar | *Visual | NONE | NONE | NONE |
| Sand/Dirt | scalar | *Visual | NONE | NONE | NONE |
| Appearance | scalar | *Visual | NORML | NORML | NORML |
| Odor | scalar | *Visual | NORML | NORML | NORML |
| Emulsified Water | scalar | *Visual | >.1 | NEG | NEG |
| Free Water | scalar | *Visual | | NEG | NEG |

| FLUID PROPERTIES | method | limit/base | current | history1 | history2 |
|------------------|--------|----------------|------------|----------|----------|
| Visc @ 40°C | cSt | ASTM D445 95.0 | 104 | 102 | 102.4 |

| SAMPLE IMAGES | method | limit/base | current | history1 | history2 |
|---------------|--------|------------|---------|----------|----------|
|---------------|--------|------------|---------|----------|----------|

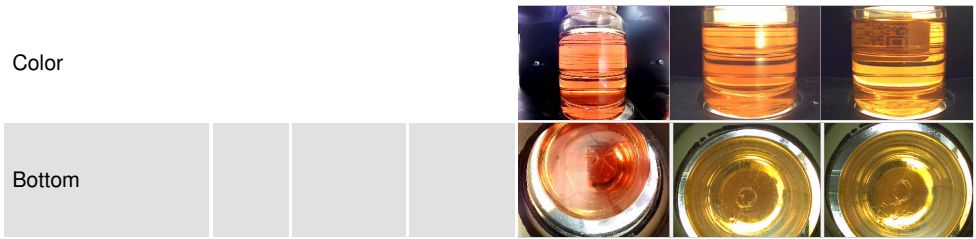

GRAPHS

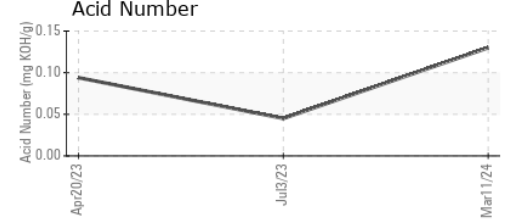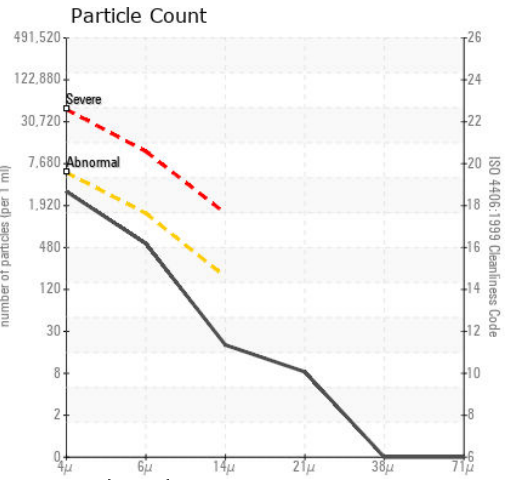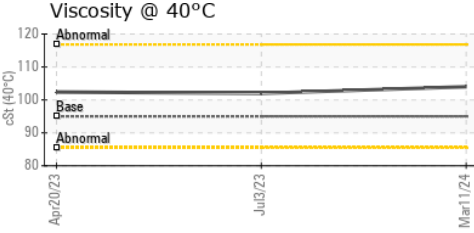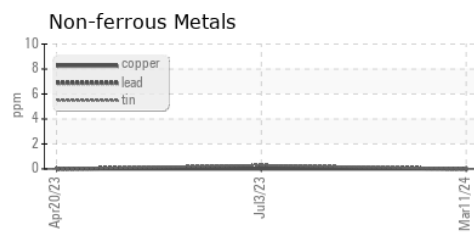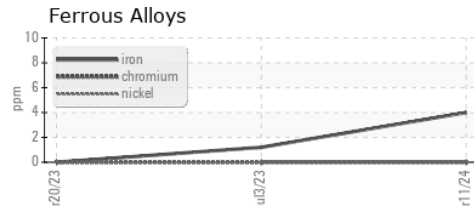

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0872482 **Received** : 01 Apr 2024
Lab Number : **06134861** **Tested** : 08 Apr 2024
Unique Number : 10954326 **Diagnosed** : 08 Apr 2024 - Jonathan Hester
Test Package : IND 2 (Additional Tests: PrtCount)

PAPILLION FOODS
 10808 S 132ND ST
 OMAHA, NE
 US 68138
 Contact: NEIL ARIANO
 njariano@hormel.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)