

Area


PALASYN 45

Machine Id

SULLIVAN PALATEK 19LE000650 - BERGEYS CHEVROLET

Component

Compressor

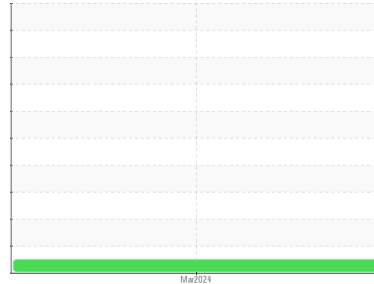

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION method limit/base current history1 history2

Sample Number	Client Info	UCS06135083	---	---
Sample Date	Client Info	25 Mar 2024	---	---
Machine Age	hrs Client Info	36009	---	---
Oil Age	hrs Client Info	4722	---	---
Oil Changed	Client Info	Changed	---	---
Sample Status		NORMAL	---	---

CONTAMINATION method limit/base current history1 history2

Water	WC Method	>0.1	NEG	---	---
-------	-----------	------	------------	-----	-----

WEAR METALS method limit/base current history1 history2

Iron	ppm	ASTM D5185m	>50	0	---	---
Chromium	ppm	ASTM D5185m	>10	<1	---	---
Nickel	ppm	ASTM D5185m		<1	---	---
Titanium	ppm	ASTM D5185m		0	---	---
Silver	ppm	ASTM D5185m		0	---	---
Aluminum	ppm	ASTM D5185m	>25	0	---	---
Lead	ppm	ASTM D5185m	>25	0	---	---
Copper	ppm	ASTM D5185m	>50	0	---	---
Tin	ppm	ASTM D5185m	>15	0	---	---
Vanadium	ppm	ASTM D5185m		0	---	---
Cadmium	ppm	ASTM D5185m		0	---	---

ADDITIVES method limit/base current history1 history2

Boron	ppm	ASTM D5185m	0.0	0	---	---
Barium	ppm	ASTM D5185m	0.0	13	---	---
Molybdenum	ppm	ASTM D5185m	0	0	---	---
Manganese	ppm	ASTM D5185m	0	<1	---	---
Magnesium	ppm	ASTM D5185m	0.0	0	---	---
Calcium	ppm	ASTM D5185m	0.0	<1	---	---
Phosphorus	ppm	ASTM D5185m	966	485	---	---
Zinc	ppm	ASTM D5185m	0	0	---	---
Sulfur	ppm	ASTM D5185m	1309	1179	---	---



CONTAMINANTS method limit/base current history1 history2

Silicon	ppm	ASTM D5185m	>25	<1	---	---
Sodium	ppm	ASTM D5185m		2	---	---
Potassium	ppm	ASTM D5185m	>20	2	---	---

FLUID DEGRADATION method limit/base current history1 history2

Acid Number (AN)	mg KOH/g	ASTM D8045	0.172	0.16	---	---
------------------	----------	------------	-------	-------------	-----	-----



OIL ANALYSIS REPORT

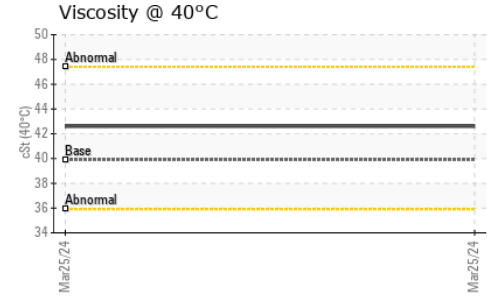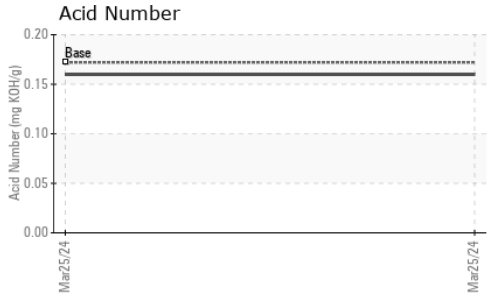





VISUAL	method	limit/base	current	history1	history2	
White Metal	scalar	*Visual	NONE	NONE	---	---
Yellow Metal	scalar	*Visual	NONE	NONE	---	---
Precipitate	scalar	*Visual	NONE	NONE	---	---
Silt	scalar	*Visual	NONE	NONE	---	---
Debris	scalar	*Visual	NONE	NONE	---	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---	---
Appearance	scalar	*Visual	NORML	NORML	---	---
Odor	scalar	*Visual	NORML	NORML	---	---
Emulsified Water	scalar	*Visual	>0.1	NEG	---	---
Free Water	scalar	*Visual		NEG	---	---

FLUID PROPERTIES	method	limit/base	current	history1	history2	
Visc @ 40°C	cSt	ASTM D445	39.9	42.6	---	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

Color				no image	no image
Bottom				no image	no image

GRAPHS

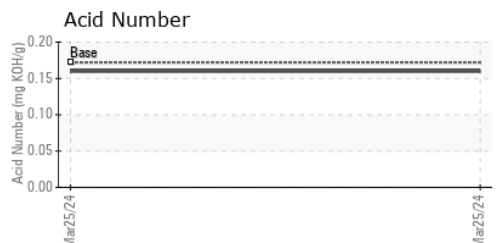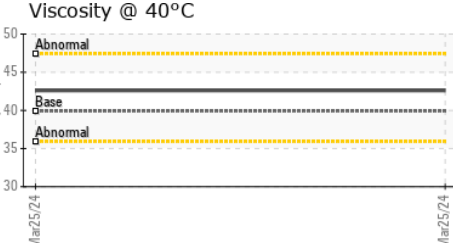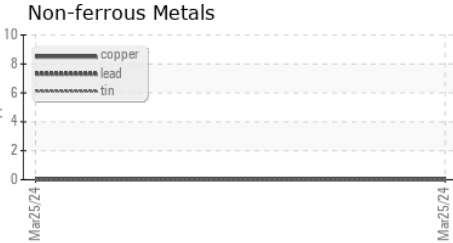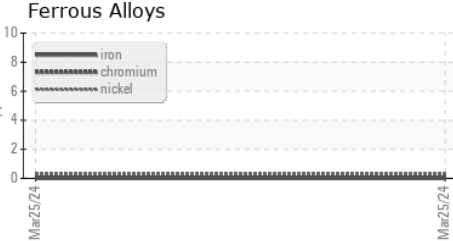

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : UCS06135083 **Received** : 01 Apr 2024
Lab Number : **06135083** **Tested** : 02 Apr 2024
Unique Number : 10954548 **Diagnosed** : 03 Apr 2024 - Sean Felton
Test Package : IND 2

STAR MAINTENANCE LTD
 612 LONELY RD
 SELLERSVILLE, PA
 US 18960
 Contact: PAUL SEACHRIST
 PSEACHRIST@VERIZON.NET
 T: (216)723-0540
 F: (216)723-1760

To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)