


# OIL ANALYSIS REPORT

Sample Rating Trend



**WATER**

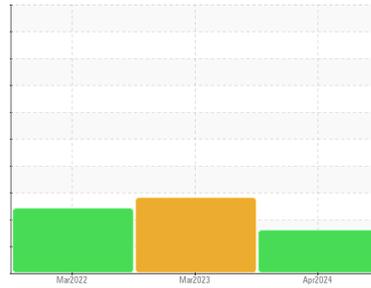

Machine Id  
**FRICK PROPANE 1**  
 Component  
**Refrigeration Compressor**  
 Fluid  
**SUMMIT PGI 100 (--- GAL)**

**DIAGNOSIS**

**Recommendation**

No corrective action is recommended at this time. Resample at the next service interval to monitor.

**Wear**

All component wear rates are normal.

**Contamination**

There is a trace of moisture present in the oil. The amount and size of particulates present in the system are acceptable.

**Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION	method	limit/base	current	history1	history2
Sample Number	Client Info		<b>TO90003173</b>	TO90002300	TO9012582
Sample Date	Client Info		<b>01 Apr 2024</b>	20 Mar 2023	08 Mar 2022
Machine Age	hrs	Client Info	<b>0</b>	0	0
Oil Age	hrs	Client Info	<b>0</b>	0	0
Oil Changed	Client Info		<b>N/A</b>	N/A	N/A
Sample Status			<b>MARGINAL</b>	ABNORMAL	ATTENTION

WEAR METALS	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >8	<b>7</b>	2	0
Chromium	ppm	ASTM D5185m >2	<b>&lt;1</b>	0	0
Nickel	ppm	ASTM D5185m	<b>&lt;1</b>	<1	0
Titanium	ppm	ASTM D5185m	<b>&lt;1</b>	0	0
Silver	ppm	ASTM D5185m >2	<b>0</b>	0	<1
Aluminum	ppm	ASTM D5185m >3	<b>2</b>	1	<1
Lead	ppm	ASTM D5185m >2	<b>&lt;1</b>	0	0
Copper	ppm	ASTM D5185m >8	<b>&lt;1</b>	0	0
Tin	ppm	ASTM D5185m >4	<b>2</b>	<1	<1
Antimony	ppm	ASTM D5185m	<b>---</b>	---	0
Vanadium	ppm	ASTM D5185m	<b>&lt;1</b>	<1	0
Cadmium	ppm	ASTM D5185m	<b>&lt;1</b>	0	0






ADDITIVES	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	<b>0</b>	0	2
Barium	ppm	ASTM D5185m	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m	<b>&lt;1</b>	<1	0
Manganese	ppm	ASTM D5185m	<b>&lt;1</b>	0	0
Magnesium	ppm	ASTM D5185m	<b>&lt;1</b>	2	0
Calcium	ppm	ASTM D5185m	<b>8</b>	4	1
Phosphorus	ppm	ASTM D5185m	<b>13</b>	30	33
Zinc	ppm	ASTM D5185m	<b>0</b>	3	0
Sulfur	ppm	ASTM D5185m	<b>0</b>	5	0

CONTAMINANTS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >15	<b>5</b>	4	6
Sodium	ppm	ASTM D5185m	<b>3</b>	0	0
Potassium	ppm	ASTM D5185m >20	<b>2</b>	<1	0
Water	%	ASTM D6304 >0.01	<b>▲ 0.030</b>	▲ 0.033	▲ 0.025
ppm Water	ppm	ASTM D6304 >100	<b>▲ 301</b>	▲ 335.2	▲ 255.6

FLUID CLEANLINESS	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>10000	<b>3288</b>	▲ 31786	● 18653
Particles >6µm	ASTM D7647	>2500	<b>652</b>	▲ 8123	● 3099
Particles >14µm	ASTM D7647	>320	<b>32</b>	289	78
Particles >21µm	ASTM D7647	>80	<b>7</b>	50	12
Particles >38µm	ASTM D7647	>20	<b>0</b>	1	1
Particles >71µm	ASTM D7647	>4	<b>0</b>	0	0
Oil Cleanliness	ISO 4406 (c)	>20/18/15	<b>19/17/12</b>	▲ 22/20/15	● 21/19/13

FLUID DEGRADATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974	<b>0.19</b>	0.028	0.028

# OIL ANALYSIS REPORT

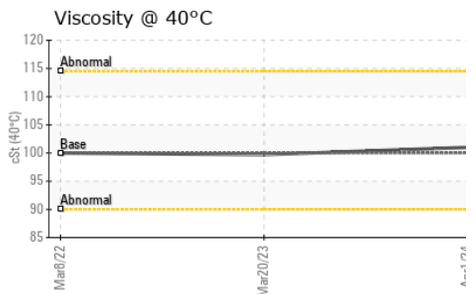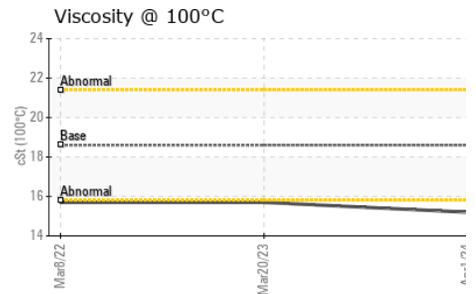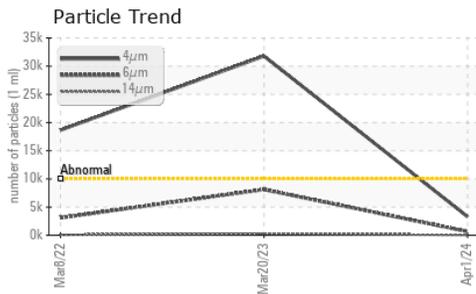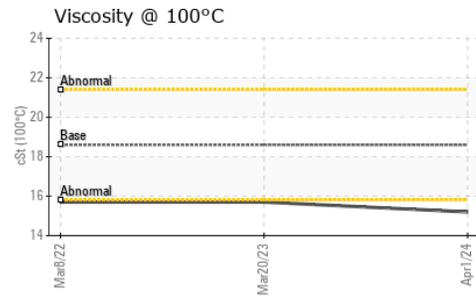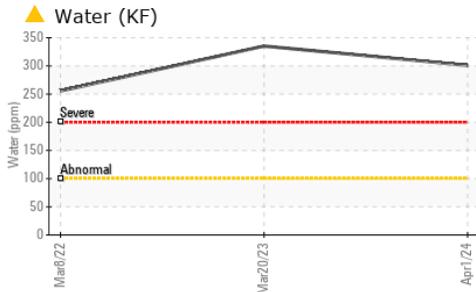






VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE
Precipitate	scalar	*Visual	NONE	<b>NONE</b>	NONE
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	VLITE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML
Emulsified Water	scalar	*Visual	>0.01	<b>NEG</b>	NEG
Free Water	scalar	*Visual		<b>NEG</b>	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	100	<b>101</b>	99.7
Visc @ 100°C	cSt	ASTM D445	18.6	<b>15.2</b>	15.7
Viscosity Index (VI)	Scale	ASTM D2270	185	<b>158</b>	167

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------



## GRAPHS

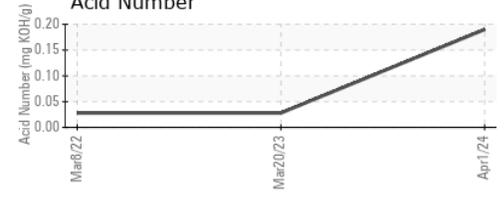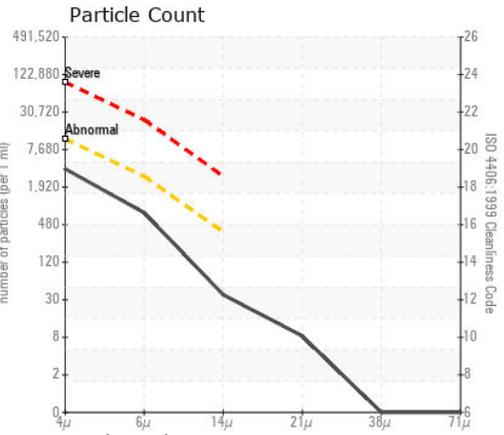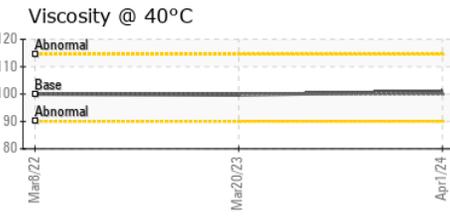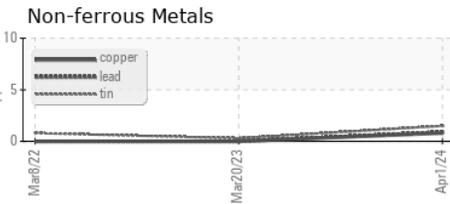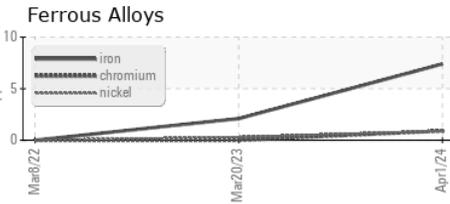

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : TO90003173  
**Lab Number** : 06135731  
**Unique Number** : 10955196  
**Test Package** : IND 2 ( Additional Tests: KV100, PrtCount, VI )  
**Received** : 02 Apr 2024  
**Tested** : 03 Apr 2024  
**Diagnosed** : 04 Apr 2024 - Jonathan Hester

**ENERGY TRANSFER - WAHA**  
 2821 WAHA RD  
 COYANOSA, TX  
 US 79730  
 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.  
 \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.  
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)