




OIL ANALYSIS REPORT

Sample Rating Trend

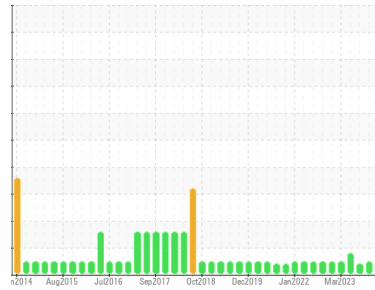

VIS DEBRIS



Machine Id
INGERSOL RAND B AIR COMPRESSOR
 Component
Air Compressor
 Fluid
TECHTROL GOLD III (20 GAL)

DIAGNOSIS

Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

Moderate concentration of visible dirt/debris present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		RP0035957	RP0035904	RP0035840
Sample Date	Client Info		26 Mar 2024	02 Jan 2024	03 Oct 2023
Machine Age	hrs	Client Info	0	0	0
Oil Age	hrs	Client Info	0	0	0
Oil Changed	Client Info		N/A	N/A	N/A
Sample Status			ABNORMAL	NORMAL	ABNORMAL

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >50	0	<1	4
Chromium	ppm	ASTM D5185m >4	0	<1	<1
Nickel	ppm	ASTM D5185m >4	1	0	0
Titanium	ppm	ASTM D5185m	0	<1	0
Silver	ppm	ASTM D5185m	0	0	0
Aluminum	ppm	ASTM D5185m >10	<1	2	2
Lead	ppm	ASTM D5185m >20	<1	0	0
Copper	ppm	ASTM D5185m >40	0	<1	<1
Tin	ppm	ASTM D5185m >5	<1	<1	0
Vanadium	ppm	ASTM D5185m	0	<1	0
Cadmium	ppm	ASTM D5185m	0	0	<1

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0	0
Barium	ppm	ASTM D5185m	370	403	445
Molybdenum	ppm	ASTM D5185m	0	0	0
Manganese	ppm	ASTM D5185m	<1	0	0
Magnesium	ppm	ASTM D5185m	0	0	1
Calcium	ppm	ASTM D5185m	0	2	1
Phosphorus	ppm	ASTM D5185m	0	35	9
Zinc	ppm	ASTM D5185m	0	0	0

CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >25	0	<1	1
Sodium	ppm	ASTM D5185m	5	6	3
Potassium	ppm	ASTM D5185m >20	4	2	2
Water	%	ASTM D6304 >0.6	0.172	0.163	0.213
ppm Water	ppm	ASTM D6304 >6000	1724	1638	2136.5




FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.11	0.05	0.09

VISUAL


	method	limit/base	current	history1	history2
White Metal	scalar	*Visual NONE	NONE	LIGHT	NONE
Yellow Metal	scalar	*Visual NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual NONE	NONE	NONE	NONE
Silt	scalar	*Visual NONE	NONE	NONE	NONE
Debris	scalar	*Visual NONE	▲ MODER	NONE	▲ MODER
Sand/Dirt	scalar	*Visual NONE	NONE	NONE	NONE
Appearance	scalar	*Visual NORML	NORML	NORML	NORML
Odor	scalar	*Visual NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual >0.6	NEG	NEG	NEG
Free Water	scalar	*Visual	NEG	NEG	NEG

OIL ANALYSIS REPORT


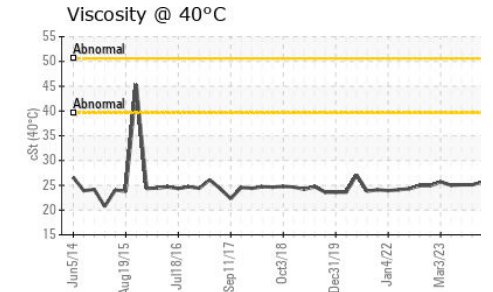
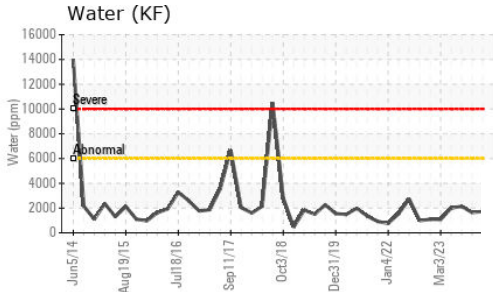
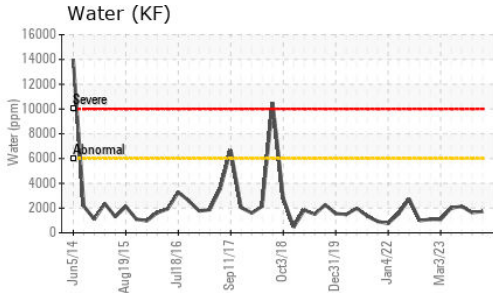


FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	25.6	25.1	25.1

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

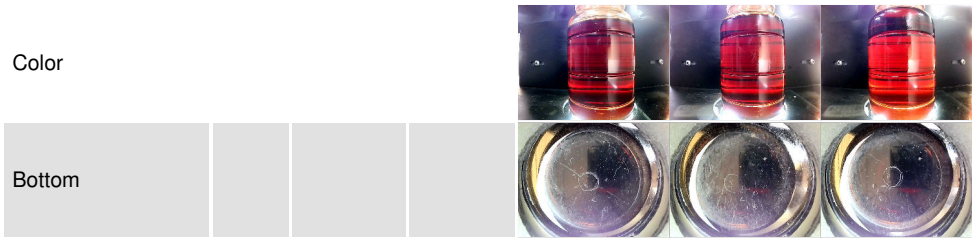

GRAPHS

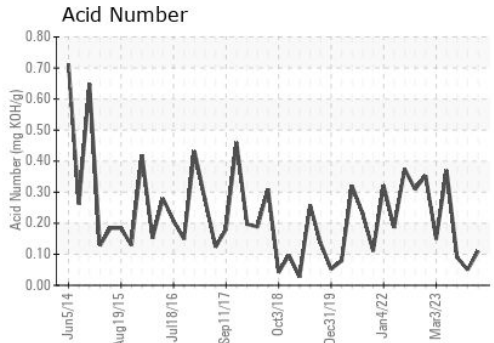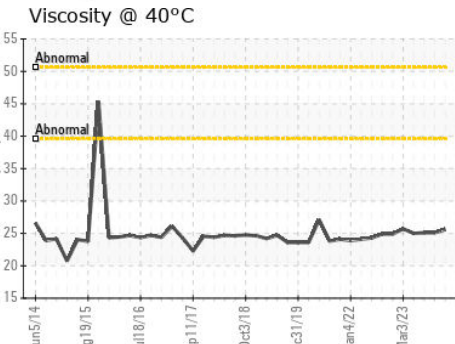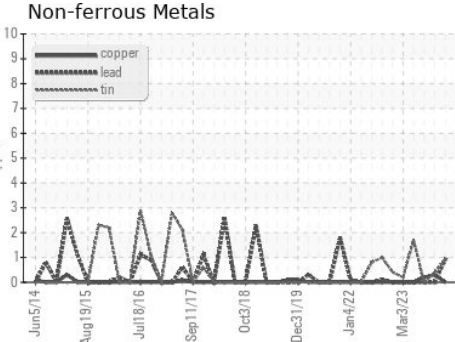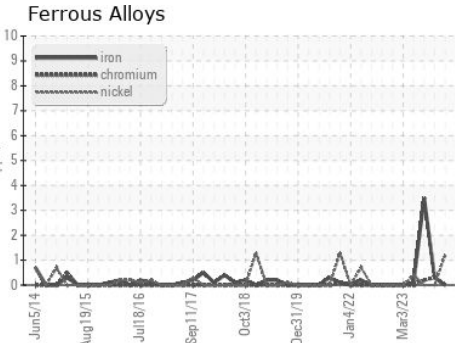

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : RP0035957
Lab Number : 06139315
Unique Number : 10964123
Test Package : IND 2
Received : 04 Apr 2024
Tested : 05 Apr 2024
Diagnosed : 06 Apr 2024 - Don Baldrige

OXY VINYL DEER PARK PVC
 1000 TIDAL ROAD
 DEER PARK, TX
 US 77536

Contact: CHARLES LOVE
 charles_love@oxy.com

T: (281)476-2277

F: (281)476-2604

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)