

OIL ANALYSIS REPORT



Machine Id

MB1581 Component Hydraulic System AW HYDRAULIC OIL ISO 46 (--- QTS)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

A Wear

The copper level is abnormal. All other component wear rates are normal.

Contamination


There is no indication of any contamination in the oil.


Fluid Condition


The condition of the oil is acceptable for the time in service.


SAMPLE INFORM		method	limit/base	current	history1	history2
Sample Number		Client Info		HRE0000324		
Sample Date		Client Info		06 Apr 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
CONTAMINATION	1	method	limit/base	current	history1	history2
Water		WC Method	>0.05	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	10		
Chromium	ppm	ASTM D5185m	>20	0		
Nickel	ppm	ASTM D5185m	>20	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>20	0		
Lead	ppm	ASTM D5185m	>20	2		
Copper	ppm	ASTM D5185m	>20	<u> </u>		
Tin	ppm	ASTM D5185m	>20	<1		
Vanadium	ppm	ASTM D5185m	20	0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	5	0		
Barium	ppm	ASTM D5185m	5	0		
Molybdenum	ppm	ASTM D5185m	5	0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	25	<1		
Calcium	ppm	ASTM D5185m	200	67		
Phosphorus	ppm	ASTM D5185m	300	341		
Zinc	ppm	ASTM D5185m	370	421		
Sulfur	ppm	ASTM D5185m	2500	1217		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	<1		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	0		
VISUAL						
VIOUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	history1	history2
White Metal Yellow Metal	scalar scalar	*Visual *Visual	NONE NONE			
White Metal Yellow Metal Precipitate		*Visual *Visual *Visual	NONE NONE NONE	NONE NONE NONE		
White Metal Yellow Metal Precipitate Silt	scalar	*Visual *Visual *Visual *Visual	NONE NONE NONE NONE	NONE NONE		
White Metal Yellow Metal Precipitate Silt	scalar scalar	*Visual *Visual *Visual	NONE NONE NONE	NONE NONE NONE NONE NONE		
White Metal	scalar scalar scalar scalar scalar	*Visual *Visual *Visual *Visual	NONE NONE NONE NONE	NONE NONE NONE NONE		
White Metal Yellow Metal Precipitate Silt Debris	scalar scalar scalar scalar	*Visual *Visual *Visual *Visual *Visual	NONE NONE NONE NONE	NONE NONE NONE NONE NONE		
White Metal Yellow Metal Precipitate Silt Debris Sand/Dirt	scalar scalar scalar scalar scalar	*Visual *Visual *Visual *Visual *Visual	NONE NONE NONE NONE NONE	NONE NONE NONE NONE NONE	 	
White Metal Yellow Metal Precipitate Silt Debris Sand/Dirt Appearance	scalar scalar scalar scalar scalar scalar	*Visual *Visual *Visual *Visual *Visual *Visual	NONE NONE NONE NONE NONE NORE	NONE NONE NONE NONE NONE NORE	 	

OIL ANALYSIS REPORT

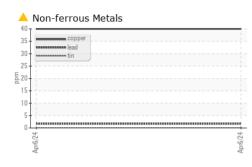

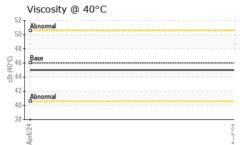

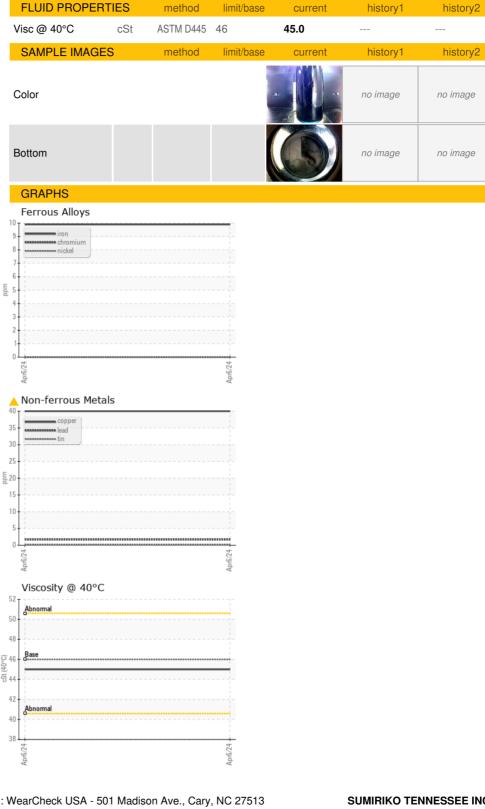

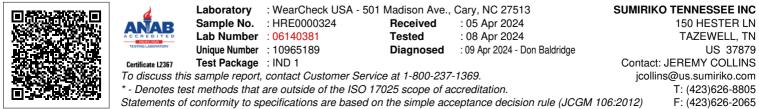

Report Id: DTRTAZ [WUSCAR] 06140381 (Generated: 04/09/2024 11:12:52) Rev: 1

Contact/Location: JEREMY COLLINS - DTRTAZ