


# **OIL ANALYSIS REPORT**

# **ROTO XTEND [419924] ATLAS COPCO ITJ674205 - HULLCO GARAGE**

Component Compressor



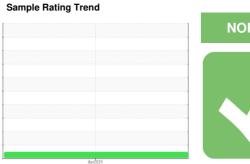

### Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the

### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06141480		
Sample Date		Client Info		01 Apr 2024		
Machine Age	hrs	Client Info		812		
Oil Age	hrs	Client Info		812		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
CONTAMINATIO	N	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	1		
Chromium	ppm	ASTM D5185m	>5	0		
Nickel	ppm	ASTM D5185m		9		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>15	0		
Lead	ppm	ASTM D5185m	>65	0		
Copper	ppm	ASTM D5185m	>65	4		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		52		
Zinc	ppm	ASTM D5185m		57		
Sulfur	ppm	ASTM D5185m		157		
CONTAMINANTS	8	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	<1		
Sodium	ppm	ASTM D5185m		3		
Potassium	ppm	ASTM D5185m	>20	0		
FLUID DEGRADA	NOITA	method	limit/base	current	history1	history2


0.084

Acid Number (AN) mg KOH/g ASTM D8045 0.14



44 42


## **OIL ANALYSIS REPORT**

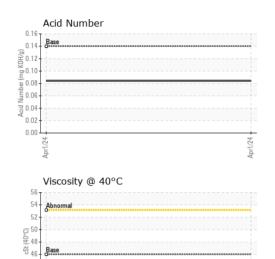


VISUAL		method				history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
<b>Emulsified Water</b>	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPERTIES		method	limit/base	current	history1	history2


Visc @ 40°C	cSt	ASTM D445	46	44.7		
SAMPLE IMAGE	ES	method	limit/base	current	history1	history2
			100			

Color no image no image **Bottom** no image no image **GRAPHS** 

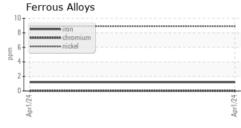

	Non-ferrous Metals	
	copper 1	
	**************************************	
mdd	enannanana tin	
ď		
	<u> </u>	-
	Apr1/24	\pr1/24
	Ap	Ap

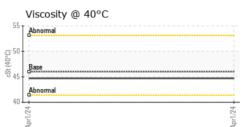

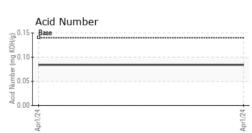





Laboratory Sample No.

Lab Number : 06141480

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : UCH06141480 Unique Number : 10966288

Received **Tested** Diagnosed

: 08 Apr 2024 : 09 Apr 2024 : 10 Apr 2024 - Angela Borella

700 WASHINGTON AVE CARLSTADT, NJ

US 07072 Contact: ELVIN DIAZ

Test Package : IND 2 Certificate 12367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

ediaz@airmaticcompressor.com;canastasio@wearcheckusa.com T: (800)864-7621

**AIRMATIC COMPRESSOR SYSTEMS** 

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (201)342-6241 Contact/Location: ELVIN DIAZ - UCAIRCAR