


OIL ANALYSIS REPORT

Area

ROTO XTEND [418675] ATLAS COPCO API276789 - NJ TRANSIT BUS GARAGE

Component Compressor

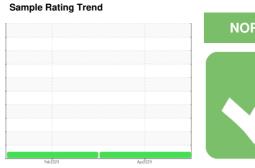



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the component.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06141488	UCH06083723	
Sample Date		Client Info		07 Apr 2024	08 Feb 2024	
Machine Age	hrs	Client Info		16400	15391	
Oil Age	hrs	Client Info		4151	3145	
Oil Changed		Client Info		N/A	N/A	
Sample Status				NORMAL	NORMAL	
CONTAMINATIO	V	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	0	
Chromium	ppm	ASTM D5185m	>5	0	0	
Nickel	ppm	ASTM D5185m		0	<1	
Titanium	ppm	ASTM D5185m		0	<1	
Silver	ppm	ASTM D5185m		0	0	
Aluminum	ppm	ASTM D5185m	>15	0	1	
Lead	ppm	ASTM D5185m	>65	0	<1	
Copper	ppm	ASTM D5185m	>65	0	<1	
Tin	ppm	ASTM D5185m	>10	0	<1	
Vanadium	ppm	ASTM D5185m		0	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	
Barium	ppm	ASTM D5185m		0	0	
Molybdenum	ppm	ASTM D5185m		0	<1	
Manganese	ppm	ASTM D5185m		0	0	
Magnesium	ppm	ASTM D5185m		0	2	
Calcium	ppm	ASTM D5185m		0	<1	
Phosphorus	ppm	ASTM D5185m		53	34	
Zinc	ppm	ASTM D5185m		40	133	
Sulfur	ppm	ASTM D5185m		99	27	
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	3	7	
Sodium	ppm	ASTM D5185m		1	0	
Potassium	ppm	ASTM D5185m	>20	0	1	
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.14	0.29	0.26	




OIL ANALYSIS REPORT

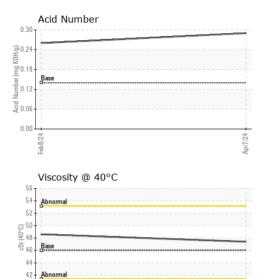



VISUAL		method				history2
White Metal	scalar	*Visual	NONE	NONE	NONE	
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	
Precipitate	scalar	*Visual	NONE	NONE	NONE	
Silt	scalar	*Visual	NONE	NONE	NONE	
Debris	scalar	*Visual	NONE	NONE	NONE	
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	
Appearance	scalar	*Visual	NORML	NORML	NORML	
Odor	scalar	*Visual	NORML	NORML	NORML	
Emulsified Water	scalar	*Visual	>0.1	NEG	NEG	
Free Water	scalar	*Visual		NEG	NEG	
FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	46	47.4	48.6	
SAMPLE IMAGES		method	limit/base	current	history1	history2
Color				PCUIP ONLY HET SAMPLED ONLY HET SAMPLED ONLY HET SAMPLED ONLY HET SAMPLED AND HET SAMP		no image
Bottom						no image

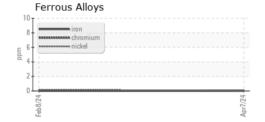

GRAPHS

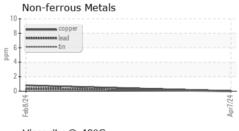

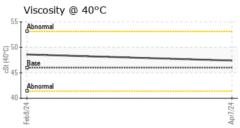

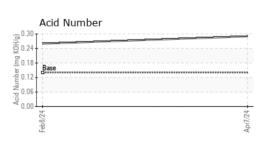





Sample No. Lab Number : 06141488

: UCH06141488 Unique Number : 10966296

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 08 Apr 2024 **Tested**

Diagnosed

: 09 Apr 2024 : 10 Apr 2024 - Angela Borella

AIRMATIC COMPRESSOR SYSTEMS 700 WASHINGTON AVE CARLSTADT, NJ

US 07072 Contact: ELVIN DIAZ

Test Package : IND 2 Certificate 12367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

ediaz@airmaticcompressor.com;canastasio@wearcheckusa.com T: (800)864-7621

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (201)342-6241 Contact/Location: ELVIN DIAZ - UCAIRCAR