


OIL ANALYSIS REPORT

ROTO X **ATLAS COPCO WUX417407**

Component Compressor

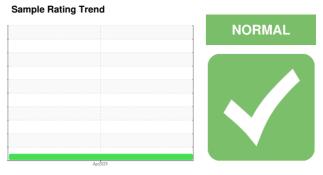

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06142352		
Sample Date		Client Info		08 Apr 2024		
Machine Age	hrs	Client Info		17393		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
CONTAMINATIO	N	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>5	<1		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		<1		
Aluminum	ppm	ASTM D5185m	>15	2		
Lead	ppm	ASTM D5185m	>65	0		
Copper	ppm	ASTM D5185m	>65	<1		
Tin	ppm	ASTM D5185m	>10	<1		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		<1		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		3		
Phosphorus	ppm	ASTM D5185m		67		
Zinc	ppm	ASTM D5185m		30		
Sulfur	ppm	ASTM D5185m		117		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	0		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	2		
FLUID DEGRADA	NOITA	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.14	0.28		



OIL ANALYSIS REPORT

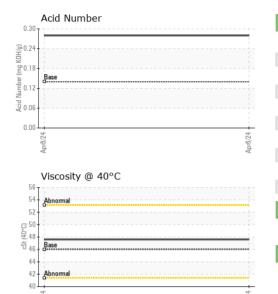

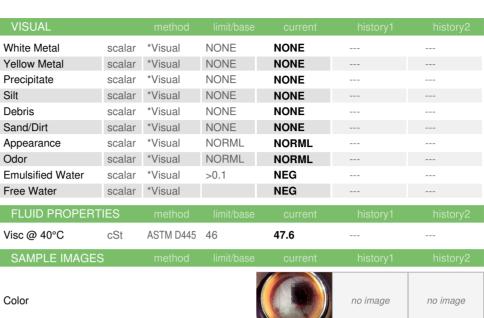



GRAPHS

Bottom



sed copper lead tin	Non-	terrous	Met							
2	8 -	copper								
2	E 6+	mana tin								
0	4									
Apr8/24 , Apr8/2	0			 	 	 	 ***	 	 	
	Apr8/24									Apr8/24

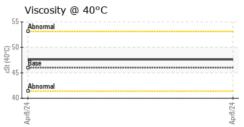

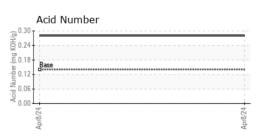

no image

no image





Certificate 12367

Laboratory

Sample No. Lab Number : 06142352

Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : UCH06142352

Unique Number : 10967160

Received **Tested** Diagnosed

: 08 Apr 2024 : 09 Apr 2024 : 11 Apr 2024 - Don Baldridge

AIRMATIC COMPRESSOR SYSTEMS 700 WASHINGTON AVE CARLSTADT, NJ US 07072

Contact: ELVIN DIAZ ediaz@airmaticcompressor.com;canastasio@wearcheckusa.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: (800)864-7621 F: (201)342-6241

Report Id: UCAIRCAR [WUSCAR] 06142352 (Generated: 04/12/2024 08:14:42) Rev: 1

Contact/Location: ELVIN DIAZ - UCAIRCAR