


OIL ANALYSIS REPORT

PNEUTECH PG-46 [167215] INGERSOLL RAND CBV275880 - SPRING-FILL

Component Compressor



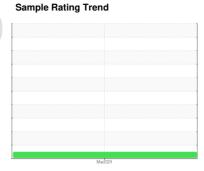

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCZ06143171		
Sample Date		Client Info		13 Mar 2024		
Machine Age	hrs	Client Info		45737		
Oil Age	hrs	Client Info		2000		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINATIO	V	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	0		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	0		
Tin	ppm	ASTM D5185m	>15	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		299		
Zinc	ppm	ASTM D5185m		10		
Sulfur	ppm	ASTM D5185m		0		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0		
Sodium	ppm	ASTM D5185m		3		
Potassium	ppm	ASTM D5185m	>20	0		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.11		



OIL ANALYSIS REPORT

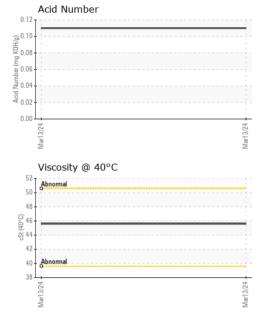


VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPERTIES		method	limit/base	current	history1	history2


/isc @ 40°C cSt		ASTM D445		45.6	
SAMPLE IMAGE	S	method			history2


Color	no image	e no image
Bottom	no image	e no image
ODADUO		

GRAPHS

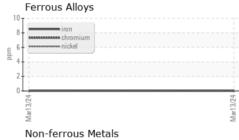

10	errous M					
8 -	copper i					
E 6-	m tin					
4						
0						
Mar13/24						Mar13/24
_	ity @ 40					Ĭ

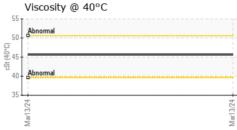

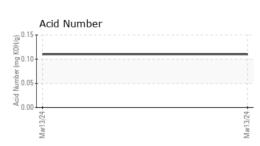





Certificate 12367

Sample No.

Lab Number : 06143171 Unique Number : 10967979

Test Package : IND 2

: UCZ06143171

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 09 Apr 2024 **Tested** : 10 Apr 2024 Diagnosed

: 11 Apr 2024 - Sean Felton

227 AMBROSIO DR, SUITE A GURNEE, IL US 60031

ZORN COMPRESSOR EQUIPMENT

Contact: Rachel Pesnikov rachel.pesnikov@zornair.com T: (847)599-1333

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: x: