


# **OIL ANALYSIS REPORT**

Area
S-460
Machine Id

# ATLAS COPCO ATLAS COPCO GA75 - POET (S/N NOT GIVEN)

Component Compressor

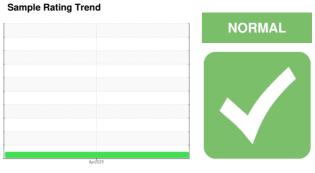

### Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the


### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06143187		
Sample Date		Client Info		02 Apr 2024		
Machine Age	hrs	Client Info		41819		
Oil Age	hrs	Client Info		4000		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
CONTAMINATIO	V	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>5	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>15	0		
Lead	ppm	ASTM D5185m	>65	0		
Copper	ppm	ASTM D5185m	>65	<1		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m	90	0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	90	0		
Calcium	ppm	ASTM D5185m	2	0		
Phosphorus	ppm	ASTM D5185m		54		
Zinc	ppm	ASTM D5185m		0		
Sulfur	ppm	ASTM D5185m		0		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	0		
Sodium	ppm	ASTM D5185m		1		
Potassium	ppm	ASTM D5185m	>20	0		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.4	0.25		




## **OIL ANALYSIS REPORT**

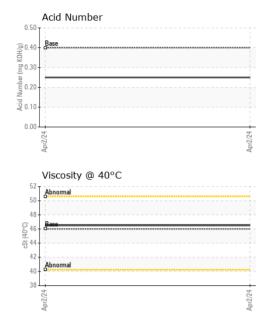


VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
<b>Emulsified Water</b>	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPERT	TES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	46	46.5		


SAIVII LL IIVIAGLS	method		Thistory i	HISTOLYZ
Color			no image	no image
Bottom			no image	no image

### **GRAPHS**

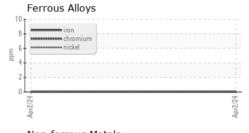

10 T	Ξ				100	n n	or																											
8 -				an j	ear	d	DII.																											
6-	****			nn t	in	_		J																										
4	-																																	
2 -	Ė				-	-					-	-	-	-	-	-	-	-					-	-	-	-	-	-	-	-	-	-		
0.	24	****	****		***		**		 ***	 	**	**	**	***				**	**	**	**		**	**	**								HA	74 20
	4pr2/2																																	Anr 2/74

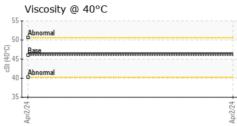

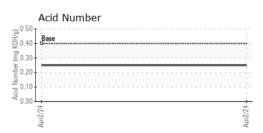





Certificate 12367

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 **Sample No.** : UCH06143187 Lab Number : 06143187

Unique Number : 10967995 Test Package : IND 2

Received : 09 Apr 2024 Tested Diagnosed

: 10 Apr 2024 : 12 Apr 2024 - Jonathan Hester

**INDUSTRIAL PNEUMATIC SYSTEMS** 700 6TH ST NW NEW PRAGUE, MN

US 56071 Contact: ROB HOFFMAN robh@ipscompressors.com

T: (952)758-9101 F: (952)758-9105

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: UCINDNEW [WUSCAR] 06143187 (Generated: 04/12/2024 14:49:12) Rev: 1

Contact/Location: ROB HOFFMAN - UCINDNEW