

OIL ANALYSIS REPORT

Sample Rating Trend

NORMAL

SMART OIL 6000 HERTZ VD020487 - DHL

Component Compressor

DI		\sim	10	0	0
	Δ		м		

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Apr2024		
SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UHK06147444		
Sample Date		Client Info		03 Apr 2024		
Machine Age	hrs	Client Info		1256		
Oil Age	hrs	Client Info		645		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINATION	I	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m		<1		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	0		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	3		
Tin	ppm	ASTM D5185m	>15	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m	20	0		
Phosphorus	ppm	ASTM D5185m		453		
Zinc	ppm	ASTM D5185m		22		
Sulfur	ppm	ASTM D5185m		1190		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	2		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	0		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2


0.086

Acid Number (AN)

mg KOH/g ASTM D8045




OIL ANALYSIS REPORT

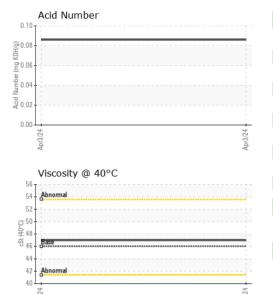



VISUAL		method				history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPERT	IES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	46	47.0		
SAMPLE IMAGES	6	method	limit/base	current	history1	history2
Color				a	no image	no image


GRAPHS

Bottom

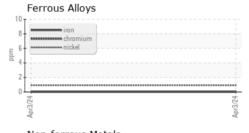

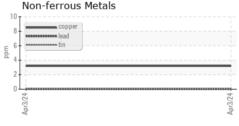

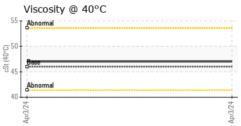

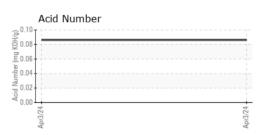

no image

no image





Laboratory Sample No. : UHK06147444 Lab Number : 06147444

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Unique Number : 10977522

Received **Tested** Diagnosed

: 12 Apr 2024 : 15 Apr 2024 : 16 Apr 2024 - Sean Felton

HERTZ KOMPRESSOREN USA INC 3320 SERVICE ST CHARLOTTE, NC US 28206 Contact: WARRANTY

warranty@hertz-kompressoren.us T: (704)579-5900

Test Package : IND 2 Certificate 12367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (704)579-5997