


# **OIL ANALYSIS REPORT**

Sample Rating Trend



**NORMAL** 

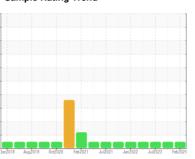

Machine Id

# COMPRESSOR 16 (S/N 1164)

Compressor

**POLYGUARD 68 (25 GAL)** 

### Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the

### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		Jec2018 Aug	2019 Oct2020 Feb202	1 Jul2021 Jan2022 Jul20	23 Feb2024	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		RP0035920	RP0032265	RP0036000
Sample Date		Client Info		08 Feb 2024	22 Oct 2023	07 Jul 2023
Machine Age	hrs	Client Info		7369	4293	2245
Oil Age	hrs	Client Info		7369	4293	2245
Oil Changed		Client Info		Not Changd	Not Changd	Not Changd
Sample Status				NORMAL	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	8	3
Chromium	ppm	ASTM D5185m	>10	0	<1	0
Nickel	ppm	ASTM D5185m		0	<1	0
Titanium	ppm	ASTM D5185m		0	<1	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>25	0	6	3
Lead	ppm	ASTM D5185m	>25	0	0	0
Copper	ppm	ASTM D5185m	>50	3	6	5
Tin	ppm	ASTM D5185m	>15	0	<1	0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		<1	<1	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		0	<1	0
Manganese	ppm	ASTM D5185m		<1	<1	<1
Magnesium	ppm	ASTM D5185m		0	<1	9
Calcium	ppm	ASTM D5185m		0	0	12
Phosphorus	ppm	ASTM D5185m		111	463	338
Zinc	ppm	ASTM D5185m		55	193	235
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0	<1	<1
Sodium	ppm	ASTM D5185m		0	<1	2
Potassium	ppm	ASTM D5185m	>20	0	<1	0
Water	%	ASTM D6304	>0.1	0.002	0.008	0.005
ppm Water	ppm	ASTM D6304	>1000	24	87	54.6
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.67	0.99	0.14
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
<b>Emulsified Water</b>	scalar	*Visual	>0.1	NEG	NEG	NEG


ationide IS TOVAR NEAEMON

NEG


scalar \*Visual





## **OIL ANALYSIS REPORT**

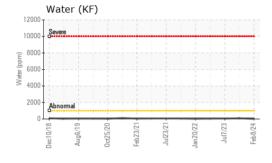





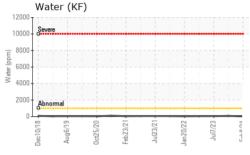


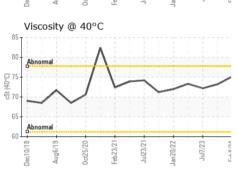

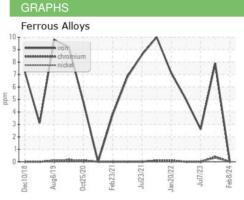

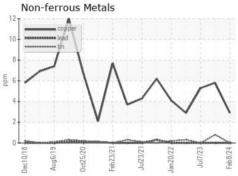

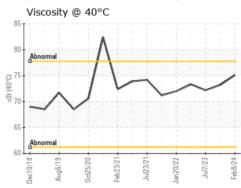

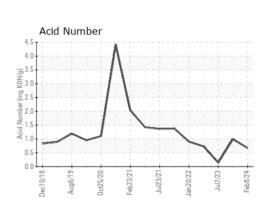





Laboratory Sample No.

: RP0035920 Lab Number : 06148748 Unique Number : 10978826

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 15 Apr 2024 **Tested** : 16 Apr 2024

**PAESA** CHAPULTEPEC 304-A COL. REGINA

Diagnosed : 17 Apr 2024 - Don Baldridge

MONTERREY, NLContact: LUIS TOVAR luistovar@grupoati.com

Test Package : IND 2 Certificate 12367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: PAEMON [WUSCAR] 06148748 (Generated: 04/17/2024 21:59:58) Rev: 1

Contact/Location: LUIS TOVAR - PAEMON

T:

F: