

OIL ANALYSIS REPORT

Samp





VOLVO A45G 353636

Component
Drop Box

VOLVO SUPER GEAR OIL 75W-80-GO102 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil


Fluid Condition

The condition of the oil is acceptable for the time in service.

L 73W-00-00102 (UAL)					
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		ML0000621		
Sample Date		Client Info		10 Apr 2024		
Machine Age	hrs	Client Info		884		
Oil Age	hrs	Client Info		385		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINATIC	N	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>500	60		
Chromium	ppm	ASTM D5185m	>20	<1		
Nickel	ppm	ASTM D5185m	>10	<1		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>30	2		
Lead	ppm	ASTM D5185m	>30	1		
Copper	ppm	ASTM D5185m	>30	3		
Tin	ppm	ASTM D5185m	>20	0		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		263		
Barium	ppm	ASTM D5185m		3		
Molybdenum	ppm	ASTM D5185m		4		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		8		
Calcium	ppm	ASTM D5185m		53		
Phosphorus	ppm	ASTM D5185m		2346		
Zinc	ppm	ASTM D5185m		34		
Sulfur		ASTM D5185m		48145		
	ppm					
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	7		
Sodium	ppm	ASTM D5185m		8		
Potassium	ppm	ASTM D5185m	>20	2		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.2	NEG		
Free Water	scalar	*Visual		NEG		
S:07:11) Rev: 1				Submit	ted By: Service	- Alex Andersor





OIL ANALYSIS REPORT

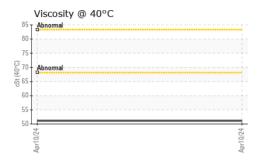




Ferrous Alloys

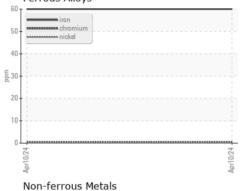

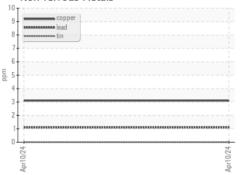

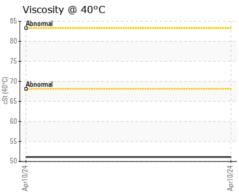



Certificate 12367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. **Lab Number** : 06150740 Unique Number : 10980818

: ML0000621 Test Package : CONST

Received Tested

: 16 Apr 2024 : 17 Apr 2024 Diagnosed : 18 Apr 2024 - Don Baldridge

MCCLUNG-LOGAN EQUIPMENT CO - RICHMOND 1345 MOUNTAIN ROAD

GLEN ALLEN, VA US 23060

Contact: Alex Anderson aanderson@mcclung-logan.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: VOLVO8882 [WUSCAR] 06150740 (Generated: 04/18/2024 16:07:11) Rev: 1

Submitted By: Service - Alex Anderson

F: (804)266-1611