



OIL ANALYSIS REPORT

Sample Rating Trend



NORMAL



Machine Id
VOLVO A45G 353636
 Component
Front Axle
 Fluid
VOLVO SUPER GEAR OIL 75W-80-GO102 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The condition of the oil is acceptable for the time in service.

| SAMPLE INFORMATION | | method | limit/base | current | history1 | history2 |
|--------------------|-------------|-------------|------------|--------------------|----------|----------|
| Sample Number | Client Info | | | ML0000622 | --- | --- |
| Sample Date | Client Info | | | 10 Apr 2024 | --- | --- |
| Machine Age | hrs | Client Info | | 884 | --- | --- |
| Oil Age | hrs | Client Info | | 884 | --- | --- |
| Oil Changed | Client Info | | | Changed | --- | --- |
| Sample Status | | | | NORMAL | --- | --- |

| CONTAMINATION | | method | limit/base | current | history1 | history2 |
|---------------|-----------|--------|------------|------------|----------|----------|
| Water | WC Method | | >0.2 | NEG | --- | --- |


| WEAR METALS | | method | limit/base | current | history1 | history2 |
|-------------|-----|-------------|------------|--------------|----------|----------|
| Iron | ppm | ASTM D5185m | >900 | 130 | --- | --- |
| Chromium | ppm | ASTM D5185m | >20 | 1 | --- | --- |
| Nickel | ppm | ASTM D5185m | >10 | <1 | --- | --- |
| Titanium | ppm | ASTM D5185m | | <1 | --- | --- |
| Silver | ppm | ASTM D5185m | | <1 | --- | --- |
| Aluminum | ppm | ASTM D5185m | >30 | <1 | --- | --- |
| Lead | ppm | ASTM D5185m | >50 | 0 | --- | --- |
| Copper | ppm | ASTM D5185m | >150 | 2 | --- | --- |
| Tin | ppm | ASTM D5185m | >20 | 0 | --- | --- |
| Vanadium | ppm | ASTM D5185m | | <1 | --- | --- |
| Cadmium | ppm | ASTM D5185m | | 0 | --- | --- |

| ADDITIVES | | method | limit/base | current | history1 | history2 |
|------------|-----|-------------|------------|--------------|----------|----------|
| Boron | ppm | ASTM D5185m | | 293 | --- | --- |
| Barium | ppm | ASTM D5185m | | 4 | --- | --- |
| Molybdenum | ppm | ASTM D5185m | | 3 | --- | --- |
| Manganese | ppm | ASTM D5185m | | 7 | --- | --- |
| Magnesium | ppm | ASTM D5185m | | 8 | --- | --- |
| Calcium | ppm | ASTM D5185m | | 127 | --- | --- |
| Phosphorus | ppm | ASTM D5185m | | 2401 | --- | --- |
| Zinc | ppm | ASTM D5185m | | 53 | --- | --- |
| Sulfur | ppm | ASTM D5185m | | 51957 | --- | --- |

| CONTAMINANTS | | method | limit/base | current | history1 | history2 |
|--------------|-----|-------------|------------|----------|----------|----------|
| Silicon | ppm | ASTM D5185m | >50 | 2 | --- | --- |
| Sodium | ppm | ASTM D5185m | | 4 | --- | --- |
| Potassium | ppm | ASTM D5185m | >20 | 5 | --- | --- |

| VISUAL | | method | limit/base | current | history1 | history2 |
|------------------|--------|---------|------------|--------------|----------|----------|
| White Metal | scalar | *Visual | NONE | NONE | --- | --- |
| Yellow Metal | scalar | *Visual | NONE | NONE | --- | --- |
| Precipitate | scalar | *Visual | NONE | NONE | --- | --- |
| Silt | scalar | *Visual | NONE | MODER | --- | --- |
| Debris | scalar | *Visual | NONE | NONE | --- | --- |
| Sand/Dirt | scalar | *Visual | NONE | NONE | --- | --- |
| Appearance | scalar | *Visual | NORML | NORML | --- | --- |
| Odor | scalar | *Visual | NORML | NORML | --- | --- |
| Emulsified Water | scalar | *Visual | >0.2 | NEG | --- | --- |
| Free Water | scalar | *Visual | | NEG | --- | --- |




OIL ANALYSIS REPORT

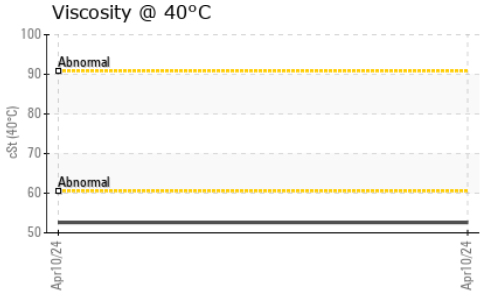

| FLUID PROPERTIES | method | limit/base | current | history1 | history2 |
|------------------|--------|------------|-------------|----------|----------|
| Visc @ 40°C | cSt | ASTM D445 | 52.6 | --- | --- |

| SAMPLE IMAGES | method | limit/base | current | history1 | history2 |
|---------------|--------|------------|----------|----------|----------|
| Color | | | no image | no image | no image |
| Bottom | | | no image | no image | no image |

GRAPHS

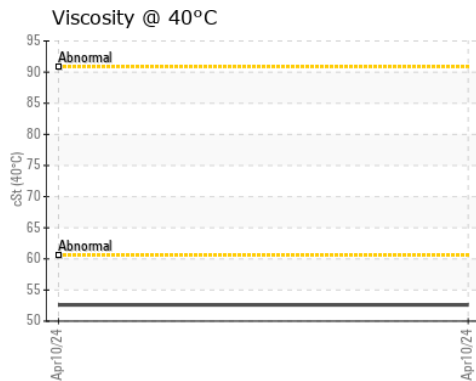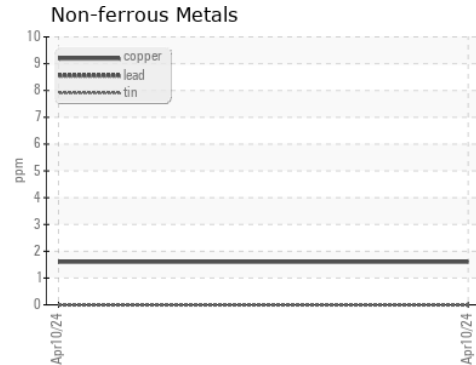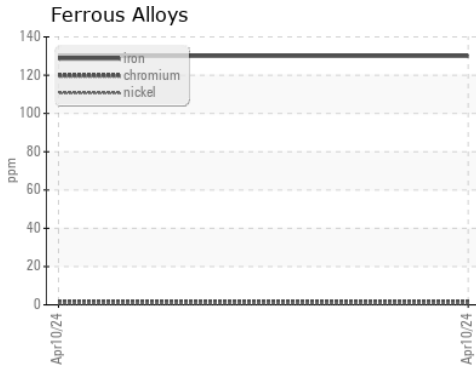

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : ML0000622
Lab Number : **06150741**
Unique Number : 10980819
Test Package : CONST

Received : 16 Apr 2024
Tested : 17 Apr 2024
Diagnosed : 18 Apr 2024 - Don Baldrige

McCLUNG-LOGAN EQUIPMENT CO - RICHMOND
 1345 MOUNTAIN ROAD
 GLEN ALLEN, VA
 US 23060
 Contact: Alex Anderson
 aanderson@mcclung-logan.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (804)266-1611