


# **OIL ANALYSIS REPORT**

Sample Rating Trend



NORMAL

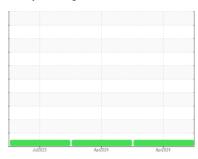

M120
Component
Bottom Gearbox
Fluid

GEAR OIL SAE 80W90 (--- GAL)

#### DIAGNOSIS

Machine Id

## Recommendation

Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

#### Wear

All component wear rates are normal.

## Contamination

There is no indication of any contamination in the oil.


## **Fluid Condition**

The condition of the oil is acceptable for the time in service.


Jul2023 Apr2024 Apr2024						
SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0858469	WC0924831	WC0831060
Sample Date		Client Info		15 Apr 2024	14 Apr 2024	30 Jul 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINATION	J	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	36	35	54
Chromium	ppm	ASTM D5185m	>10	<1	<1	<1
Nickel	ppm	ASTM D5185m	>10	0	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>25	1	1	1
Lead	ppm	ASTM D5185m	>50	0	0	0
Copper	ppm	ASTM D5185m	>200	0	0	1
Tin	ppm	ASTM D5185m	>10	0	0	0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	400	4	5	2
Barium	ppm	ASTM D5185m	200	0	0	0
Molybdenum	ppm	ASTM D5185m	12	1	2	0
Manganese	ppm	ASTM D5185m		0	0	<1
Magnesium	ppm	ASTM D5185m	12	19	23	2
Calcium	ppm	ASTM D5185m	150	57	72	29
Phosphorus	ppm	ASTM D5185m	1650	724	704	552
Zinc	ppm	ASTM D5185m	125	143	167	53
Sulfur	ppm	ASTM D5185m	22500	21763	21084	19587
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	8	8	8
Sodium	ppm	ASTM D5185m	>170	<1	<1	1
Potassium	ppm	ASTM D5185m	>20	2	2	2
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG





## **OIL ANALYSIS REPORT**

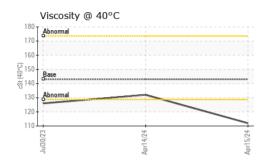



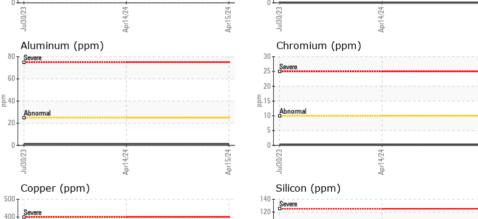

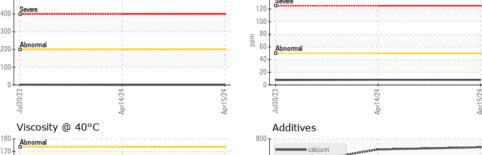

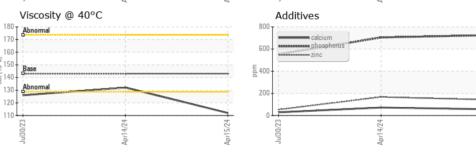



Laboratory Sample No.

Lab Number : 06151356 Unique Number : 10981434

: WC0858469

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

Received : 16 Apr 2024 **Tested** 

: 18 Apr 2024

Diagnosed : 18 Apr 2024 - Wes Davis

Test Package : MOB 1 Certificate 12367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

**INTERSTATE WASTE-NEWARK** 

110 EVERGREEN AVE, BAY 3 NEWARK, NJ

US 07114

Contact: Robert Witynski RWitynski@interstatewaste.com

T: F:

Report Id: INT110NEW [WUSCAR] 06151356 (Generated: 04/18/2024 00:21:41) Rev: 1

Contact/Location: Robert Witynski - INT110NEW