


OIL ANALYSIS REPORT

Sample Rating Trend



NORMAL

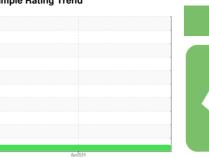

Machine Id

KENWORTH 397609

Component Transmission (Manual)

TULCO LUBSOIL TO-4 50 (5)

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the fluid.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the fluid is suitable for further service.

				Apr2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		TO10003490		
Sample Date		Client Info		09 Apr 2024		
Machine Age	hrs	Client Info		7204		
Oil Age	hrs	Client Info		1026		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINATION	V	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
PQ		ASTM D8184	>95	15		
Iron	ppm	ASTM D5185m	>200	10		
Chromium	ppm	ASTM D5185m	>5	0		
Nickel	ppm	ASTM D5185m	>5	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m	>7	0		
Aluminum	ppm	ASTM D5185m	>25	0		
Lead	ppm	ASTM D5185m	>45	0		
Copper	ppm	ASTM D5185m	>225	5		
Tin	ppm	ASTM D5185m	>10	<1		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		2		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		21		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		1		
Calcium	ppm	ASTM D5185m		287		
Phosphorus	ppm	ASTM D5185m		239		
Zinc	ppm	ASTM D5185m		93		
Sulfur	ppm	ASTM D5185m		7801		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>125	1		
Sodium	ppm	ASTM D5185m		2		
Potassium	ppm	ASTM D5185m	>20	0		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
	1/011/	4 OT1 4 D00 45				


0.39

Acid Number (AN)

mg KOH/g ASTM D8045



OIL ANALYSIS REPORT

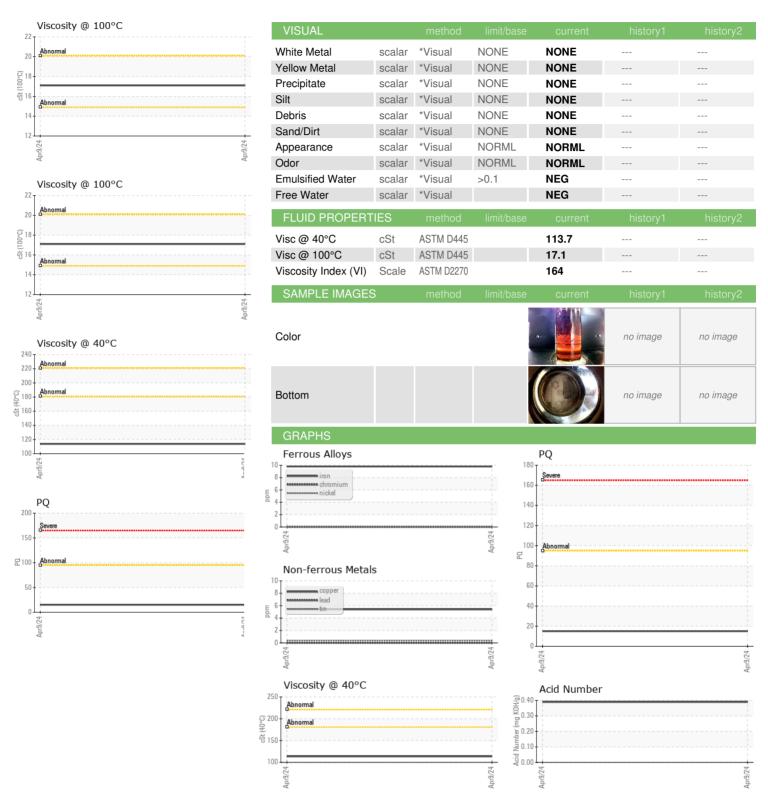



Certificate 12367

Laboratory Sample No.

Lab Number : 06154772

: TO10003490 Unique Number : 10990195

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 19 Apr 2024 **Tested** : 25 Apr 2024

Diagnosed : 25 Apr 2024 - Jonathan Hester Test Package : IND 2 (Additional Tests: KV100, PQ, VI) To discuss this sample report, contact Customer Service at 1-800-237-1369.

 st - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

KLX ENERGY SERVICES

5104 ESTES PKWY LONGVIEW, TX US 75603

Contact: DUSTIN TREST dustin.trest@klx.com

T: F: