

### **OIL ANALYSIS REPORT**

Sample Rating Trend



Machine Id

# GOODYEAR AKRON TEST 67

Hydraulic System Fluid CONOCO MEGAFLOW AW 46 (--- GAL)

#### DIAGNOSIS

#### A Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor. Due to an abnormal test result it is recommended to contact Stauff Corp at (201)-444-7800 for help resolving the issue.

#### Wear

All component wear rates are normal.

#### Contamination

There is a high amount of particulates present in the oil.

#### Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	ATION	method	limit/base	current	history1	history2
Sample Number		Client Info		ST46143	ST44388	
Sample Date		Client Info		21 Apr 2024	02 Jan 2023	
Machine Age	hrs	Client Info		0	0	
Oil Age	hrs	Client Info		0	0	
Oil Changed		Client Info		N/A	N/A	
Sample Status				ABNORMAL	NORMAL	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	2	1	
Chromium	ppm	ASTM D5185m	>20	<1	0	
Nickel	ppm	ASTM D5185m	>20	<1	0	
Titanium	ppm	ASTM D5185m		<1	0	
Silver	ppm	ASTM D5185m		0	0	
Aluminum	ppm	ASTM D5185m	>20	2	0	
Lead	ppm	ASTM D5185m	>20	<1	0	
Copper	ppm	ASTM D5185m	>20	17	18	
Tin	ppm	ASTM D5185m	>20	<1	<1	
Vanadium	ppm	ASTM D5185m		<1	0	
Cadmium	ppm	ASTM D5185m		<1	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	
Barium	ppm	ASTM D5185m		<1	0	
Molybdenum	ppm	ASTM D5185m		<1	0	
Manganese	ppm	ASTM D5185m		0	0	
Magnesium	ppm	ASTM D5185m		<1	0	
Calcium	ppm	ASTM D5185m		20	11	
Phosphorus	ppm	ASTM D5185m		322	277	
Zinc	ppm	ASTM D5185m		296	225	
Sulfur	ppm	ASTM D5185m		795	788	
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	1	<1	
Sodium	ppm	ASTM D5185m		3	2	
Potassium	ppm	ASTM D5185m	>20	2	0	
Water	%	ASTM D6304	>0.05	0.001	0.007	
ppm Water	ppm	ASTM D6304	>500	7	71.9	
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>640	<b>664</b>	317	
Particles >6µm		ASTM D7647	>160	<u> </u>	91	
Particles >14µm		ASTM D7647	>20	<b>4</b> 1	6	
Particles >21µm		ASTM D7647	>4	<u> </u>	2	
Particles >38µm		ASTM D7647	>3	2	0	
Particles >71µm		ASTM D7647	>3	0	0	
Oil Cleanliness		ISO 4406 (c)	>16/14/11	<b>A</b> 17/15/13	15/14/10	
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.38	0.36	0.31	

Contact/Location: SCOTT ROGERS - FLUHIL Page 1 of 2



42

40 Abnorma

3

## **OIL ANALYSIS REPORT**


method


limit/base

current

history1

history2

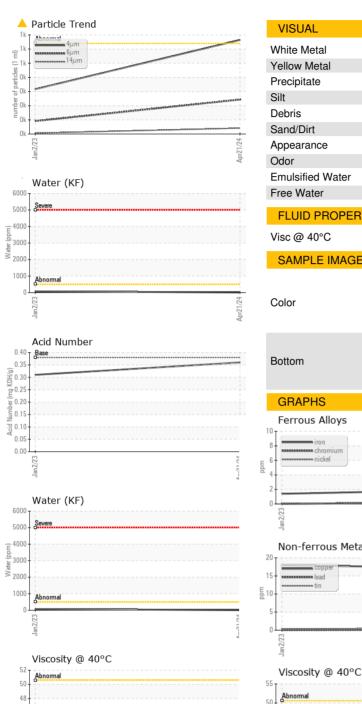

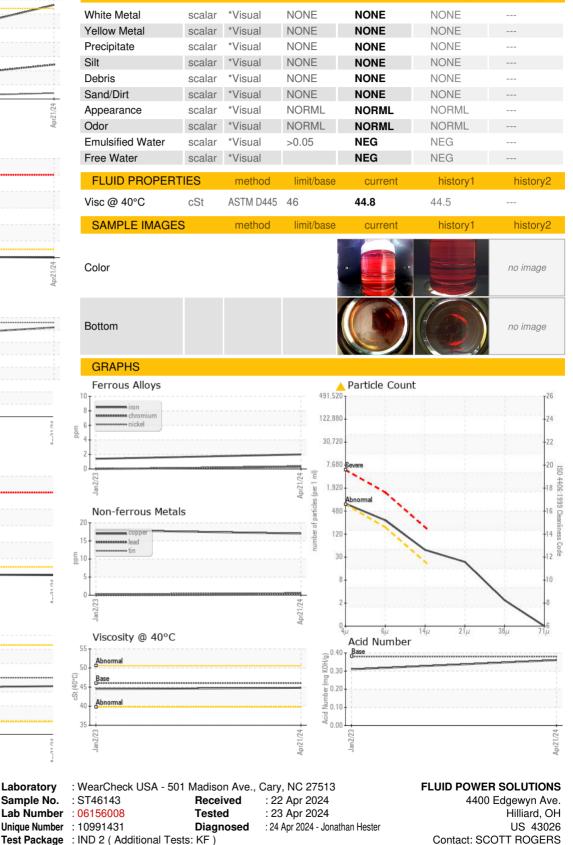

To discuss this sample report, contact Customer Service at 1-800-237-1369.

45

40

35

Jan 2/23

ŝ

Laboratory

Sample No.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (614)777-8640

Certificate 12367

Contact/Location: SCOTT ROGERS - FLUHIL

srogers@fluid-power-solutions.com

T: (614)777-8954