

# **OIL ANALYSIS REPORT**

### Sample Rating Trend



Machine Id

# **DUNHAM BUSH 25 A C1 (S/N JMC-X0709-19)**

Screw Compressor

WITCO 4GS (--- GAL)

### Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the

### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		Apr2019	May2020	Apr2022 May2023	Apr2024	
SAMPLE INFORM	//ATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0812046	WC0784187	WC0677986
Sample Date		Client Info		16 Apr 2024	04 May 2023	13 Apr 2022
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>60	1	0	<1
Chromium	ppm	ASTM D5185m	>4	<1	0	0
Nickel	ppm	ASTM D5185m		<1	0	0
Titanium	ppm	ASTM D5185m		<1	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>5	2	0	0
Lead	ppm	ASTM D5185m	>10	0	0	0
Copper	ppm	ASTM D5185m	>30	2	1	1
Tin	ppm	ASTM D5185m	>15	<1	0	0
Antimony	ppm	ASTM D5185m				
Vanadium	ppm	ASTM D5185m		<1	0	0
Cadmium	ppm	ASTM D5185m		<1	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m		<1	0	0
Molybdenum	ppm	ASTM D5185m		<1	0	0
Manganese	ppm	ASTM D5185m		0	0	0
Magnesium	ppm	ASTM D5185m		<1	0	0
Calcium	ppm	ASTM D5185m		<1	0	0
Phosphorus	ppm	ASTM D5185m		2	0	4
Zinc	ppm	ASTM D5185m		0	0	0
Sulfur	ppm	ASTM D5185m		637	544	377
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	13	8	9
Sodium	ppm	ASTM D5185m		0	1	0
Potassium	ppm	ASTM D5185m	>20	1	0	0
Water	%	ASTM D6304	>0.1	0.00		0.006
ppm Water	ppm	ASTM D6304	>1000	0		67.3
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2

0.096


0.014


Acid Number (AN) mg KOH/g ASTM D8045


0.016



## **OIL ANALYSIS REPORT**

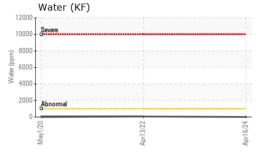

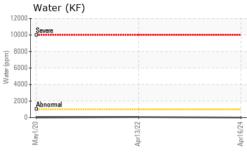

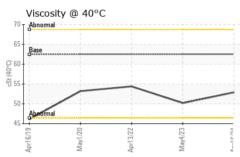

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	LIGHT	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
<b>Emulsified Water</b>	scalar	*Visual	>0.1	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG

I LOID I NOI LITTILO		IILO	memou			HISTOLAL	HISTOLYZ	
	Visc @ 40°C	cSt	ASTM D445	62.5	52.9	50.2	54.4	


SAMPLE	<b>IMAGES</b>


Color


ELLID DDODEDTIE






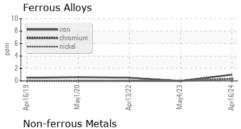

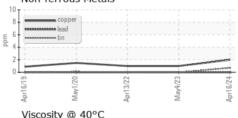

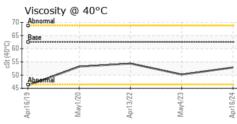

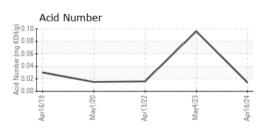





Laboratory Sample No.

Lab Number : 06156079

: WC0812046 Unique Number : 10991502

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

Received **Tested** Diagnosed

: 22 Apr 2024 : 23 Apr 2024

: 24 Apr 2024 - Sean Felton

US 08876 Contact: LARRY DELGUERCIO larry@commairsystems.com

T: (908)927-9090 F: (908)921-9091

**COMMERCIAL AIR SYSTEMS** 

10 COUNTY LINE RD

BRANCHBURG, NJ

Test Package : IND 2 ( Additional Tests: KF ) Certificate 12367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: COMBRANJ [WUSCAR] 06156079 (Generated: 04/24/2024 11:20:30) Rev: 1

Contact/Location: LARRY DELGUERCIO - COMBRANJ