


OIL ANALYSIS REPORT

EXTRA 44

SULLIVAN PALATEK 23DE003948 - BELDON INDUSTRIES

Component Compressor

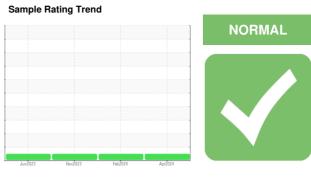

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCS06157786	UCS06090311	UCS06001082
Sample Date		Client Info		18 Apr 2024	08 Feb 2024	02 Nov 2023
Machine Age	hrs	Client Info		6921	5403	3453
Oil Age	hrs	Client Info		6921	5403	3453
Oil Changed		Client Info		Not Changd	Not Changd	Not Changd
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINATION		method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	0	0
Chromium	ppm	ASTM D5185m	>10	<1	0	0
Nickel	ppm	ASTM D5185m		0	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>25	<1	0	0
Lead	ppm	ASTM D5185m	>25	0	0	0
Copper	ppm	ASTM D5185m	>50	0	0	<1
Tin	ppm	ASTM D5185m	>15	<1	<1	0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0	0	0
Barium	ppm	ASTM D5185m	0.3	0	0	0
Molybdenum	ppm	ASTM D5185m	0	0	0	0
Manganese	ppm	ASTM D5185m	0.3	0	<1	0
Magnesium	ppm	ASTM D5185m	0.4	<1	<1	0
Calcium	ppm	ASTM D5185m	0	0	1	0
Phosphorus	ppm	ASTM D5185m	689	586	540	594
Zinc	ppm	ASTM D5185m	0	0	0	0
Sulfur	ppm	ASTM D5185m	1237	604	580	724
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	2	4	5
Sodium	ppm	ASTM D5185m		<1	0	1
Potassium	ppm	ASTM D5185m	>20	1	0	0
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.135	0.291	0.23	0.21

Sullivan

OIL ANALYSIS REPORT

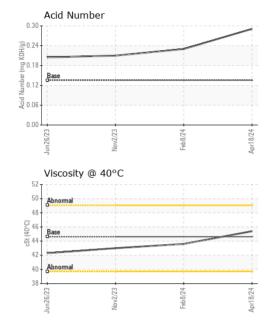

VISUAL		method				history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG
FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	44.62	45.4	43.6	43.0
SAMPLE IMAGES		method	limit/base	current	history1	history2

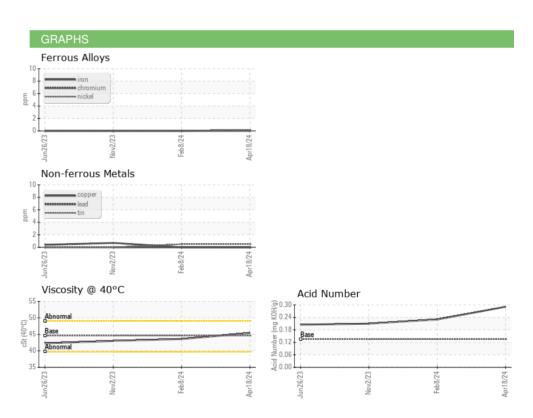





Laboratory

Sample No.

: UCS06157786 Lab Number : 06157786 Unique Number : 10993209

Color

Bottom

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received **Tested** Diagnosed

: 23 Apr 2024 : 24 Apr 2024

: 25 Apr 2024 - Sean Felton

TRI-STATE AIR COMPRESSOR 10635 RAPP RD MIDDLETOWN, OH

US 44442 Contact:

Test Package : IND 2 Certificate 12367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

tristateaircompressor@gmail.com T: (330)717-6507

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: ? ? - UCTRIMID