




OIL ANALYSIS REPORT



Machine Id
CATERPILLAR 972H 5585 (S/N A7D00894)
 Component
Rear Axle
 Fluid
{not provided} (--- GAL)

Sample Rating Trend

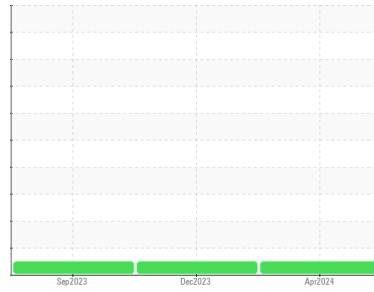

NORMAL



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.
 Please specify the brand, type, and viscosity of the oil on your next sample.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			WC0924900	WC0875484	WC0863150
Sample Date	Client Info			13 Apr 2024	15 Dec 2023	30 Sep 2023
Machine Age	hrs	Client Info		4712	3938	3216
Oil Age	hrs	Client Info		0	0	0
Oil Changed	Client Info			N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL

CONTAMINATION		method	limit/base	current	history1	history2
Water	WC Method		>0.2	NEG	NEG	NEG

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>500	104	36	383
Chromium	ppm	ASTM D5185m	>10	<1	<1	2
Nickel	ppm	ASTM D5185m	>10	<1	0	0
Titanium	ppm	ASTM D5185m		<1	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>25	2	2	2
Lead	ppm	ASTM D5185m	>25	<1	0	0
Copper	ppm	ASTM D5185m	>50	2	0	<1
Tin	ppm	ASTM D5185m	>10	<1	0	<1
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		<1	0	0


ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		2	1	1
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		5	2	24
Manganese	ppm	ASTM D5185m		1	0	3
Magnesium	ppm	ASTM D5185m		11	14	12
Calcium	ppm	ASTM D5185m		3314	3589	2552
Phosphorus	ppm	ASTM D5185m		1437	1267	959
Zinc	ppm	ASTM D5185m		1548	1627	1154
Sulfur	ppm	ASTM D5185m		14478	15015	10803

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>75	28	31	17
Sodium	ppm	ASTM D5185m		<1	0	<1
Potassium	ppm	ASTM D5185m	>20	1	2	<1

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	LIGHT	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG



OIL ANALYSIS REPORT








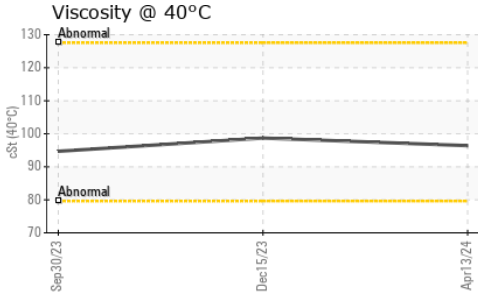


FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	96.4	98.7	94.7

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

Color				no image	no image	no image
Bottom				no image	no image	no image

GRAPHS

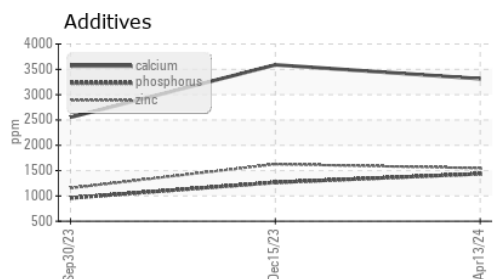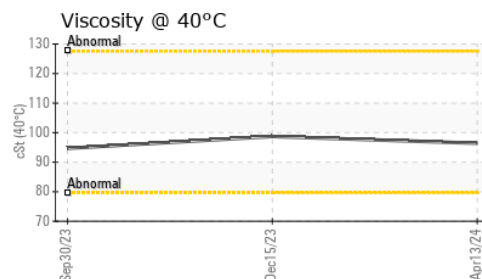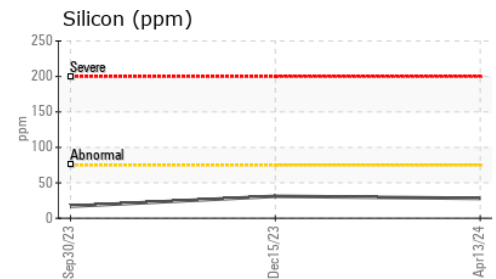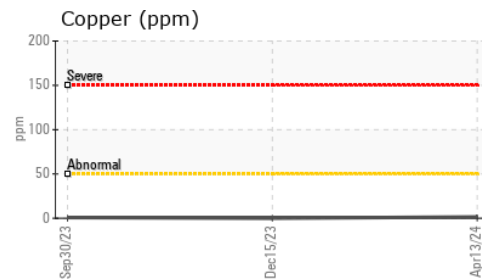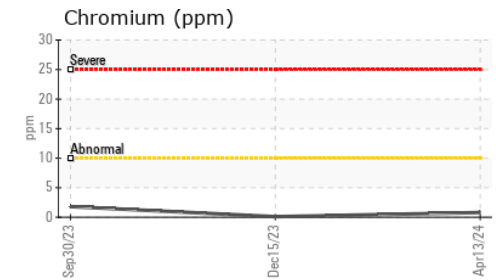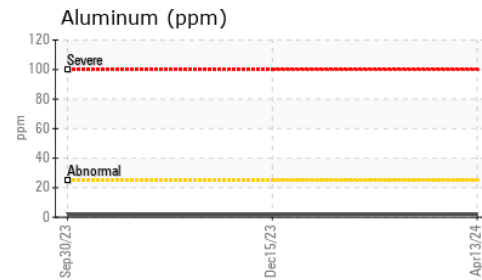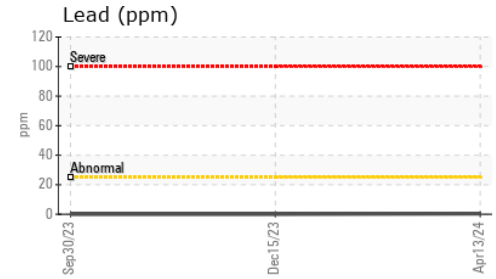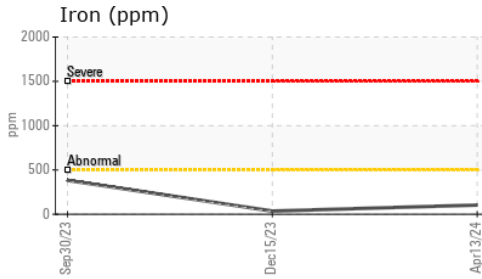

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0924900 **Received** : 23 Apr 2024
Lab Number : 06158043 **Tested** : 24 Apr 2024
Unique Number : 10993466 **Diagnosed** : 24 Apr 2024 - Wes Davis
Test Package : MOB 1

INTERSTATE WASTE-NEWARK
 110 EVERGREEN AVE, BAY 3
 NEWARK, NJ
 US 07114
 Contact: Robert Witynski
 RWitynski@interstatewaste.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
F: