


OIL ANALYSIS REPORT

FSE TURBOCOOL ISO 32
Machine Id
B7EW2E060-5

Component Compressor

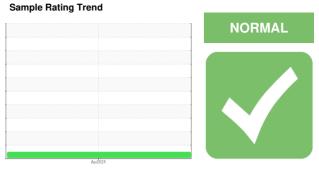

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06159264		
Sample Date		Client Info		09 Apr 2024		
Machine Age	hrs	Client Info		41462		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
CONTAMINATIO	Ν	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m		<1		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	2		
Lead	ppm	ASTM D5185m	>25	<1		
Copper	ppm	ASTM D5185m	>50	<1		
Tin	ppm	ASTM D5185m	>15	<1		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		<1		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		<1		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		3		
Phosphorus	ppm	ASTM D5185m		255		
Zinc	ppm	ASTM D5185m		0		
Sulfur	ppm	ASTM D5185m		6		
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	<1		
FLUID DEGRADA	NOITA	method	limit/base	current	history1	history2
		107117				

Acid Number (AN) mg KOH/g ASTM D8045

0.17




OIL ANALYSIS REPORT

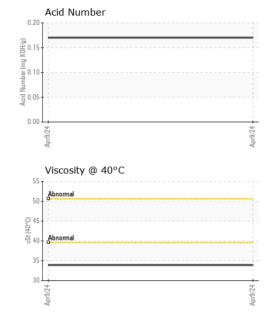


VISUAL		method				history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPERT	IFS	method	limit/base	current	history1	history2
						,=
Visc @ 40°C	cSt	ASTM D445		33.9		


SAMPLE IMAGES	method		history1	history2
Color			no image	no image
Bottom			no image	no image

GRAPHS

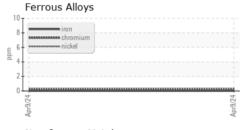

8	Ē	_		_	CO	pp	e																										
U	84		***		lea	ed																											
6	- "	~~~	****	***	tin	-)																									
4	+																																
2	Li.																																
-																																	
0	L#				***	-	-		-	**	-	 ¥	-	 **	-	-	-	-	-	-	-	-	-	 ***	 	-	 H	-	H	-	 -	-	H
	Apr9/24																																Ang And
	j.d																																Jan.

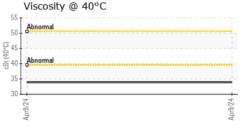

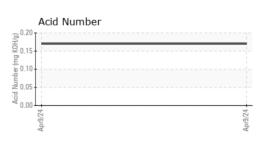





Certificate 12367

Sample No. : UCH06159264 Lab Number : 06159264

Unique Number : 10994687

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 24 Apr 2024

Tested : 25 Apr 2024 Diagnosed : 26 Apr 2024 - Jonathan Hester

RASMUSSEN AIR & GAS ENERGY

655 240TH STREET WATERLOO, NE US 68069

Contact: CHASE SVOBODA chase.svoboda@rage-energy.com

T: (402)614-9926

Test Package : IND 2 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)