


OIL ANALYSIS REPORT

Sample Rating Trend





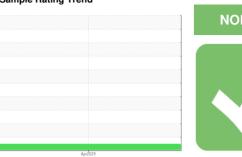

VOLVO L90G 617019
Component
Front Axle
Fluid
{not provided} (10 GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Moor

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil


Fluid Condition

The condition of the oil is acceptable for the time in service.


-)				Apr2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		ML0000991		
Sample Date		Client Info		22 Apr 2024		
Machine Age	hrs	Client Info		16223		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
CONTAMINATIO	N	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>500	64		
Chromium	ppm	ASTM D5185m	>20	<1		
Nickel	ppm	ASTM D5185m	>10	0		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>30	<1		
Lead	ppm	ASTM D5185m	>50	0		
Copper	ppm	ASTM D5185m	>120	0		
Tin	ppm	ASTM D5185m	>20	<1		
√anadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		36		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		1		
Manganese	ppm	ASTM D5185m		1		
Magnesium	ppm	ASTM D5185m		33		
Calcium	ppm	ASTM D5185m		3228		
Phosphorus	ppm	ASTM D5185m		1124		
Zinc	ppm	ASTM D5185m		1303		
Sulfur	ppm	ASTM D5185m		12375		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	7		
Sodium	ppm	ASTM D5185m		1		
Potassium	ppm	ASTM D5185m	>20	0		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.2	NEG		
Free Water	scalar	*Visual		NEG		
30:17) Rev: 1					itted Bv: Service	- William Brittle




OIL ANALYSIS REPORT

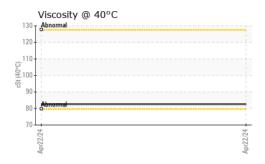



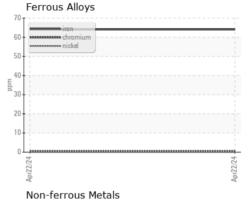

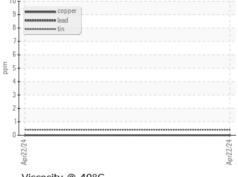

Viscosity @ 40°C







Certificate 12367

Laboratory Sample No.

Lab Number : 06159492 Unique Number : 10994915

: ML0000991 Test Package : CONST

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 24 Apr 2024 Tested : 25 Apr 2024

Diagnosed : 26 Apr 2024 - Jonathan Hester

PO BOX 600 CHANTILLY, VA US 20153 Contact: SERVICE MANAGER jimmy_elswick@wahazel.com

WILLIAM HAZEL

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. T: (703)378-8300 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)