




FUEL REPORT



Area
[SW32730-1 ELITE CONT]
 Machine Id
VOLVO EC220E 315109
 Component
Tank Diesel Fuel
 Fluid
No.2 DIESEL FUEL (ULTRALOW SULPHUR) (--- GAL)

Sample Rating Trend

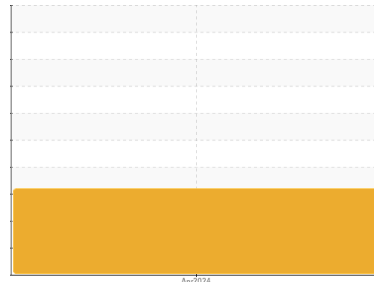

WATER



DIAGNOSIS

▲ Recommendation

We recommend drain/flush system.

Corrosion

All metal levels are normal indicating no corrosion in the cooling system.

▲ Contaminants

Sample consists almost entirely of free water. Sample appears to be entirely DEF.

Fuel Condition

The fuel is no longer serviceable due to the presence of contaminants.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		VCP446599	---	---
Sample Date	Client Info		18 Apr 2024	---	---
Machine Age	hrs	Client Info	687	---	---
Sample Status			SEVERE	---	---


CONTAMINANTS

	method	limit/base	current	history1	history2
Water	%	ASTM D6304 <0.05	76.7	---	---
ppm Water	ppm	ASTM D6304 <500	▲ 767000	---	---

SAMPLE IMAGES

	method	limit/base	current	history1	history2
Color				no image	no image
Bottom				no image	no image

FUEL REPORT

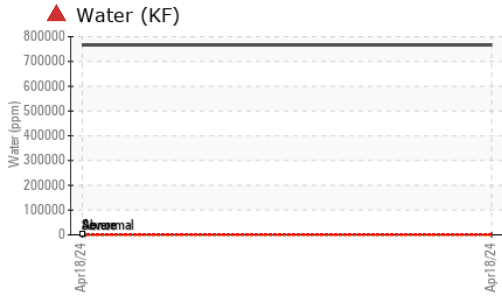

GRAPHS



Certificate L2367

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : VCP446599
Lab Number : 06159572
Unique Number : 10994995
Test Package : MOB 1 (Additional Tests: KF)

Received : 24 Apr 2024
Tested : 30 Apr 2024
Diagnosed : 30 Apr 2024 - Jonathan Hester

ARNOLD MACHINERY COMPANY
 2975 WEST 2100 SOUTH
 SALT LAKE CITY, UT
 US 84119
 Contact: TONY PAYAN
 tpayan@arnoldmachinery.com
 T: (801)972-4000
 F: (801)975-9434