



# FUEL REPORT

Sample Rating Trend



**NORMAL**



Machine Id  
**ISUZU 5067014**

Component  
**Diesel Fuel**

Fluid  
**No.2 DIESEL FUEL (ULTRALOW SULPHUR) (--- QTS)**

## DIAGNOSIS

### Recommendation

No corrective action is recommended at this time.

### Corrosion

All metal levels are normal indicating no corrosion in the system.

### Contaminants

The water content is negligible. There is no indication of any contamination in the fuel.

### Fuel Condition

The condition of the fuel is acceptable for the time in service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			<b>LF0001648</b>	---	---
Sample Date	Client Info			<b>08 May 2024</b>	---	---
Machine Age	hrs	Client Info		<b>0</b>	---	---
Sample Status				<b>NORMAL</b>	---	---

PHYSICAL PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	3.0	<b>2.46</b>	---	---

SULFUR CONTENT		method	limit/base	current	history1	history2
Sulfur	ppm	ASTM D5185m	10	<b>17</b>	---	---

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	<1.0	<b>&lt;1</b>	---	---
Sodium	ppm	ASTM D5185m	<0.1	<b>1</b>	---	---
Potassium	ppm	ASTM D5185m	<0.1	<b>&lt;1</b>	---	---
Water	%	ASTM D6304	<0.05	<b>0.002</b>	---	---
ppm Water	ppm	ASTM D6304	<500	<b>23</b>	---	---

HEAVY METALS		method	limit/base	current	history1	history2
Aluminum	ppm	ASTM D5185m	<0.1	<b>0</b>	---	---
Nickel	ppm	ASTM D5185m	<0.1	<b>0</b>	---	---
Lead	ppm	ASTM D5185m	<0.1	<b>0</b>	---	---
Vanadium	ppm	ASTM D5185m	<0.1	<b>&lt;1</b>	---	---
Iron	ppm	ASTM D5185m	<0.1	<b>0</b>	---	---
Calcium	ppm	ASTM D5185m	<0.1	<b>0</b>	---	---
Magnesium	ppm	ASTM D5185m	<0.1	<b>0</b>	---	---
Phosphorus	ppm	ASTM D5185m	<0.1	<b>&lt;1</b>	---	---
Zinc	ppm	ASTM D5185m	<0.1	<b>0</b>	---	---





SAMPLE IMAGES		method	limit/base	current	history1	history2
---------------	--	--------	------------	---------	----------	----------

Color					no image	no image
Bottom					no image	no image



# FUEL REPORT

## GRAPHS

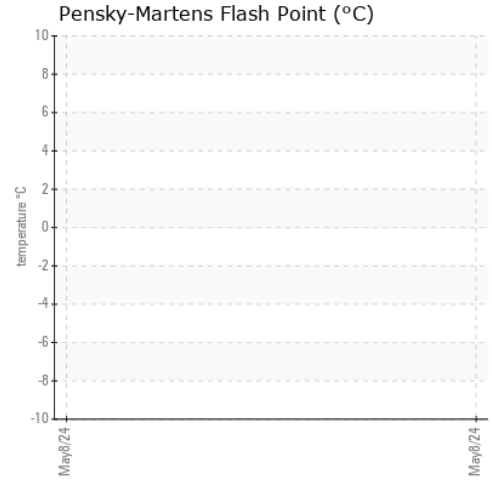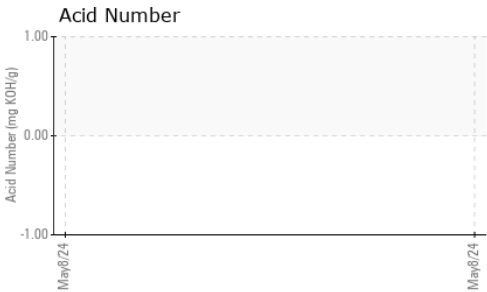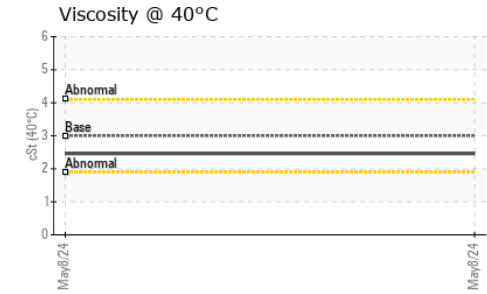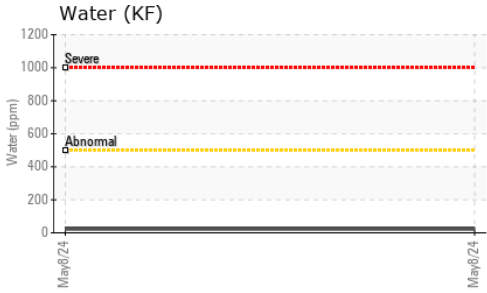

Certificate L2367

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : LF0001648  
**Lab Number** : 06178271  
**Unique Number** : 11029597  
**Test Package** : MOB 1 ( Additional Tests: KF )

**Received** : 13 May 2024  
**Tested** : 17 May 2024  
**Diagnosed** : 17 May 2024 - Jonathan Hester

**L&W DIESEL SERVICE**  
 2600 W 43RD  
 ODESSA, TX  
 US 79764  
 Contact: DREW ALLEN  
 drew@lwdiesel.com

T:  
F: