


OIL ANALYSIS REPORT



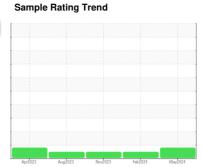

Machine Id

MLU-1
Component
Inboard Pump

CHEVRON REGAL OIL R&O 32 (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. We recommend an early resample to monitor this condition.

Wear

The tin level is abnormal. All other component wear rates are normal.

Contamination

The water content is negligible. There is no indication of any contamination in the oil.


Fluid Condition

The condition of the oil is suitable for further service.

		Apr2023	Aug2023	Nov2023 Feb2024	May 2024	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		RP0036046	RP0036124	RP0032107
Sample Date		Client Info		23 May 2024	19 Feb 2024	08 Nov 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>90	1	0	<1
Chromium	ppm	ASTM D5185m	>5	<1	<1	0
Nickel	ppm	ASTM D5185m	>5	<1	0	0
Titanium	ppm	ASTM D5185m	>3	<1	0	<1
Silver	ppm	ASTM D5185m	>3	1	0	0
Aluminum	ppm	ASTM D5185m	>7	1	0	1
Lead	ppm	ASTM D5185m	>12	<1	0	1
Copper	ppm	ASTM D5185m	>30	6	7	7
Tin	ppm	ASTM D5185m	>9	73	2	3
Vanadium	ppm	ASTM D5185m		<1	0	0
Cadmium	ppm	ASTM D5185m		<1	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		<1	0	0
Manganese	ppm	ASTM D5185m		<1	0	0
Magnesium	ppm	ASTM D5185m		76	54	86
Calcium	ppm	ASTM D5185m		0	0	4
Phosphorus	ppm	ASTM D5185m		3	<1	0
Zinc	ppm	ASTM D5185m		0	0	0
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>60	3	0	1
Sodium	ppm	ASTM D5185m		2	2	3
Potassium	ppm	ASTM D5185m	>20	1	0	<1
Water	%	ASTM D6304	>.1	0.024	0.010	0.017
ppm Water	ppm	ASTM D6304	>1000	246	104	177
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.37	0.29	0.31
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>.1	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	Submitted By: S	Service Manager



OIL ANALYSIS REPORT

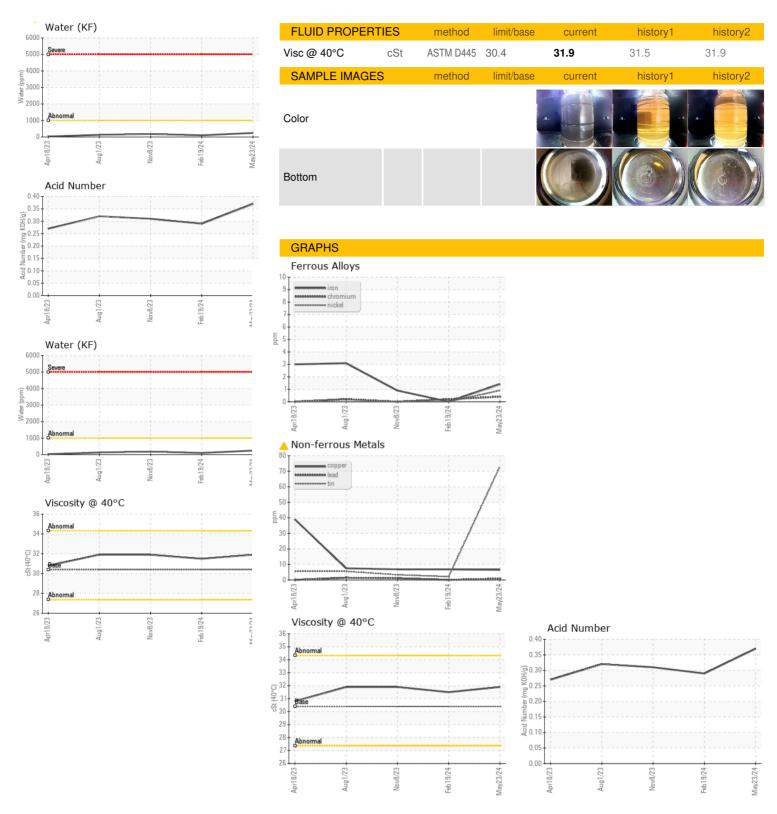





Certificate 12367

Laboratory Sample No.

Test Package : IND 2

: RP0036046 Lab Number : 06194088 Unique Number : 11056211

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 29 May 2024

Tested : 31 May 2024 Diagnosed : 31 May 2024 - Jonathan Hester

ENERGY TRANSFER - SPEARSVILLE

126 FIRE TOWER RD SPEARSVILLE, LA US 71277

Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: ENESPA [WUSCAR] 06194088 (Generated: 05/31/2024 17:10:06) Rev: 1

Submitted By: Service Manager

T:

F: