


OIL ANALYSIS REPORT

Sample Rating Trend





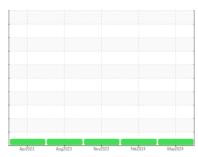

MLU-2 Outboard Pump

Machine Id

CHEVRON REGAL OIL R&O 32 (--- GAL)

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		Apr2023	Aug2023	Nov2023 Feb2024	May2024	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		RP0036558	RP0036130	RP0032109
Sample Date		Client Info		23 May 2024	19 Feb 2024	17 Nov 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>90	3	0	2
Chromium	ppm	ASTM D5185m	>5	<1	<1	0
Nickel	ppm	ASTM D5185m	>5	<1	0	<1
Titanium	ppm	ASTM D5185m	>3	<1	0	0
Silver	ppm	ASTM D5185m	>3	1	0	0
Aluminum	ppm	ASTM D5185m	>7	1	0	0
Lead	ppm	ASTM D5185m	>12	2	0	1
Copper	ppm	ASTM D5185m	>30	4	3	2
Tin	ppm	ASTM D5185m	>9	<1	0	<1
Vanadium	ppm	ASTM D5185m		<1	0	0
Cadmium	ppm	ASTM D5185m		<1	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		<1	0	0
Manganese	ppm	ASTM D5185m		<1	0	0
Magnesium	ppm	ASTM D5185m		1	0	1
Calcium	ppm	ASTM D5185m		0	0	<1
Phosphorus	ppm	ASTM D5185m		16	11	19
Zinc	ppm	ASTM D5185m		5	0	0
CONTAMINANTS	\$	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>60	12	11	11
Sodium	ppm	ASTM D5185m		1	1	4
Potassium	ppm	ASTM D5185m	>20	<1	0	<1
Water	%	ASTM D6304	>.1	0.003	0.003	0.002
ppm Water	ppm	ASTM D6304	>1000	29	29	22
FLUID DEGRADA	NOITA	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.069	0.2	0.089
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	LIGHT	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>.1	NEG	NEG	NEG
=					Cubmitted By: 9	Convice-Managor


Submitted By: Service Manager

NEG

scalar *Visual





OIL ANALYSIS REPORT

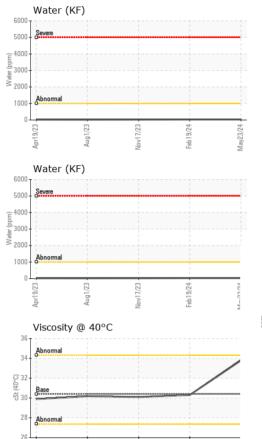



Nov17/23



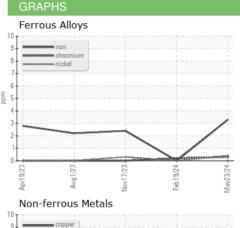

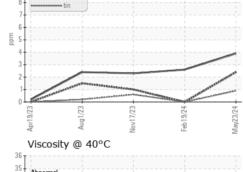

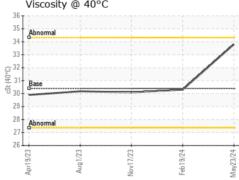

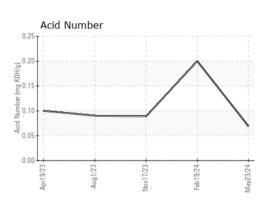





Laboratory Sample No.

Lab Number : 06194095

: RP0036558 Unique Number : 11056218

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 29 May 2024

Tested : 30 May 2024 Diagnosed : 31 May 2024 - Angela Borella

249 MID VALLEY DR HAYNESVILLE, LA

ENERGY TRANSFER - HAYNESVILLE

US 71038

Contact: Service Manager

Certificate 12367

Test Package : IND 2

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: ENEHAYLA [WUSCAR] 06194095 (Generated: 05/31/2024 09:29:12) Rev: 1

Submitted By: Service Manager

T:

F: