



# FUEL REPORT

Sample Rating Trend



**NORMAL**



Area

[W156263]

Machine Id

IAD2-B-GEN-03 IAD2-B-GEN-03

Component

Diesel Fuel

Fluid

DIESEL FUEL No. 2 (--- GAL)

## DIAGNOSIS

### Recommendation

All laboratory tests indicate that this sample meets specifications for No.2 low-sulfur diesel fuel.

### Corrosion

All metal levels are normal indicating no corrosion in the system.

### Contaminants

There is no bacteria or fungus (yeast and/or mold) indicated in the sample. The water content is negligible. There is no indication of any contamination in the fuel.

### Fuel Condition

Sulfur value derived by ASTM D5453 method for ULSD validation.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			WC0911273	---	---
Sample Date	Client Info			07 May 2024	---	---
Machine Age	hrs	Client Info		0	---	---
Sample Status				NORMAL	---	---

PHYSICAL PROPERTIES		method	limit/base	current	history1	history2
ASTM Color	scalar	*ASTM D1500		L4.5	---	---
Visc @ 40°C	cSt	ASTM D445	4.1	2.38	---	---

SULFUR CONTENT		method	limit/base	current	history1	history2
Sulfur	ppm	ASTM D5185m		21	---	---
Sulfur (UVF)	ppm	ASTM D5453		43	---	---

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	<1.0	<1	---	---
Sodium	ppm	ASTM D5185m	<0.1	2	---	---
Potassium	ppm	ASTM D5185m	<0.1	<1	---	---
Water	%	ASTM D6304	<0.05	0.002	---	---
ppm Water	ppm	ASTM D6304	<500	25	---	---
% Gasoline	%	*In-House	<0.50	0.0	---	---
% Biodiesel	%	*In-House	<20.0	0.0	---	---

HEAVY METALS		method	limit/base	current	history1	history2
Aluminum	ppm	ASTM D5185m	<0.1	0	---	---
Nickel	ppm	ASTM D5185m	<0.1	0	---	---
Lead	ppm	ASTM D5185m	<0.1	<1	---	---
Vanadium	ppm	ASTM D5185m	<0.1	<1	---	---
Iron	ppm	ASTM D5185m	<0.1	0	---	---
Calcium	ppm	ASTM D5185m	<0.1	0	---	---
Magnesium	ppm	ASTM D5185m	<0.1	<1	---	---
Phosphorus	ppm	ASTM D5185m	<0.1	<1	---	---
Zinc	ppm	ASTM D5185m	<0.1	0	---	---



SAMPLE IMAGES		method	limit/base	current	history1	history2
---------------	--	--------	------------	---------	----------	----------

Color					no image	no image
Bottom					no image	no image



# FUEL REPORT

## GRAPHS

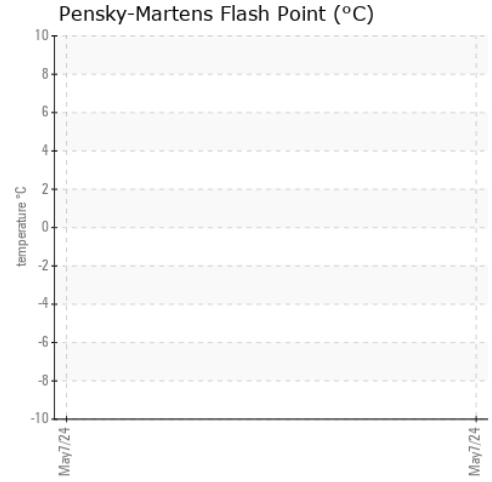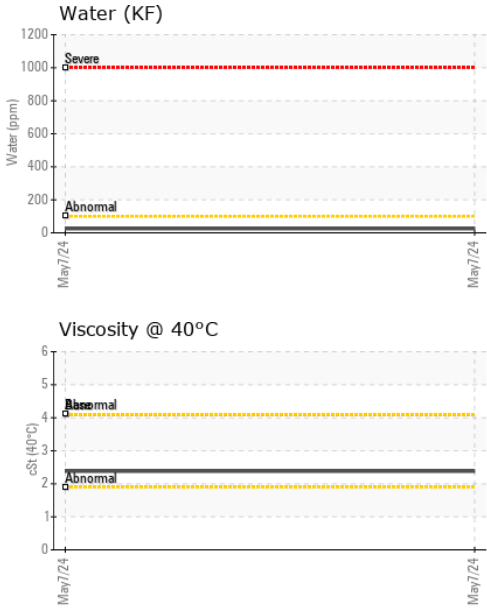

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : WC0911273 **Received** : 29 May 2024  
**Lab Number** : 06194538 **Tested** : 12 Jun 2024  
**Unique Number** : 11056661 **Diagnosed** : 12 Jun 2024 - Doug Bogart  
**Test Package** : DF-5 ( Additional Tests: PritCount, Screen )  
 To discuss this sample report, contact Customer Service at 1-800-237-1369.  
 \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.  
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

**NATIONAL POWER CORP**  
 4541 PRESLYN DR  
 RALEIGH, NC  
 US 27616  
 Contact: Brandon Daniels  
 Brandon.Daniels@natpow.com

T:  
 F: (919)790-9714