


OIL ANALYSIS REPORT

ROTO XTEND [419698] ATLAS COPCO API275761 - NJ TRANSIT BUS GARAGE

Component Compressor



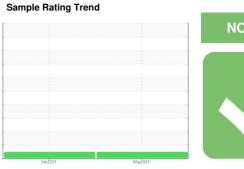

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06195558	UCH06097041	
Sample Date		Client Info		29 May 2024	21 Feb 2024	
Machine Age	hrs	Client Info		6107	5341	
Oil Age	hrs	Client Info		2049	1285	
Oil Changed		Client Info		N/A	N/A	
Sample Status				NORMAL	NORMAL	
CONTAMINATION		method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	0	
Chromium	ppm	ASTM D5185m	>5	0	<1	
Nickel	ppm	ASTM D5185m		0	0	
Titanium	ppm	ASTM D5185m		0	0	
Silver	ppm	ASTM D5185m		0	0	
Aluminum	ppm	ASTM D5185m	>15	0	0	
Lead	ppm	ASTM D5185m	>65	0	0	
Copper	ppm	ASTM D5185m	>65	0	0	
Tin	ppm	ASTM D5185m	>10	<1	0	
Vanadium	ppm	ASTM D5185m		0	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	
Barium	ppm	ASTM D5185m		0	0	
Molybdenum	ppm	ASTM D5185m		0	0	
Manganese	ppm	ASTM D5185m		<1	0	
Magnesium	ppm	ASTM D5185m		0	0	
Calcium	ppm	ASTM D5185m		0	0	
Phosphorus	ppm	ASTM D5185m		41	23	
Zinc	ppm	ASTM D5185m		47	40	
Sulfur	ppm	ASTM D5185m		152	63	
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	8	8	
Sodium	ppm	ASTM D5185m		1	0	
Potassium	ppm	ASTM D5185m	>20	0	0	
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.14	0.20	0.18	





OIL ANALYSIS REPORT

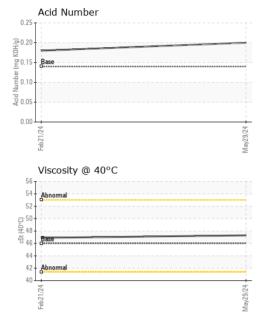

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	
Precipitate	scalar	*Visual	NONE	NONE	NONE	
Silt	scalar	*Visual	NONE	NONE	NONE	
Debris	scalar	*Visual	NONE	NONE	NONE	
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	
Appearance	scalar	*Visual	NORML	NORML	NORML	
Odor	scalar	*Visual	NORML	NORML	NORML	
Emulsified Water	scalar	*Visual	>0.1	NEG	NEG	
Free Water	scalar	*Visual		NEG	NEG	
FLUID PROPERT	IFS	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	46	47.3	46.9	
SAMPLE IMAGES		method	limit/base	current	history1	history2
Color						no image
Bottom						no image
GRAPHS						
Ferrous Alloys						
8 iron						

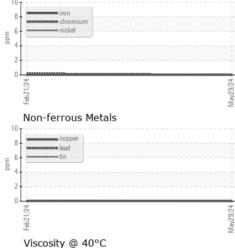

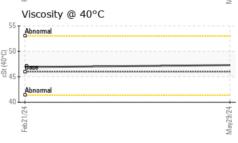

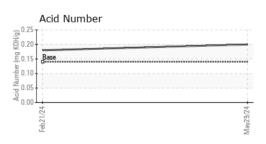





Certificate 12367

Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 **Sample No.** : UCH06195558 Lab Number : 06195558 Unique Number : 11057681

Received : 30 May 2024 **Tested** : 31 May 2024

Diagnosed : 31 May 2024 - Wes Davis

700 WASHINGTON AVE CARLSTADT, NJ

US 07072 Contact: ELVIN DIAZ ediaz@airmaticcompressor.com;canastasio@wearcheckusa.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

T: (800)864-7621 F: (201)342-6241

AIRMATIC COMPRESSOR SYSTEMS

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) Report Id: UCAIRCAR [WUSCAR] 06195558 (Generated: 05/31/2024 20:20:07) Rev: 1

Contact/Location: ELVIN DIAZ - UCAIRCAR