


# **OIL ANALYSIS REPORT**

**ROTO INJECT ATLAS COPCO API277360 - QUALCOMM** 

Component Compressor

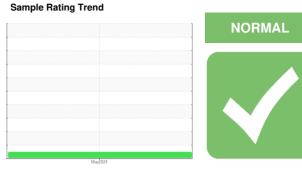

## Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

## Contamination

There is no indication of any contamination in the


## **Fluid Condition**


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06195968		
Sample Date		Client Info		29 May 2024		
Machine Age	hrs	Client Info		9634		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
CONTAMINATION	V	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>5	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>15	0		
Lead	ppm	ASTM D5185m	>65	0		
Copper	ppm	ASTM D5185m	>65	0		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m	1000	0		
Phosphorus	ppm	ASTM D5185m	510	18		
Zinc	ppm	ASTM D5185m	590	29		
Sulfur	ppm	ASTM D5185m		59		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	14		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	0		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.95	0.10		





## **OIL ANALYSIS REPORT**

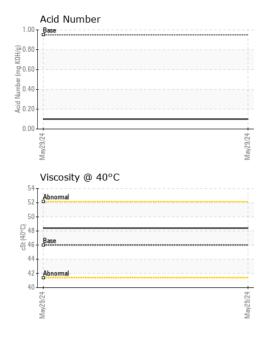


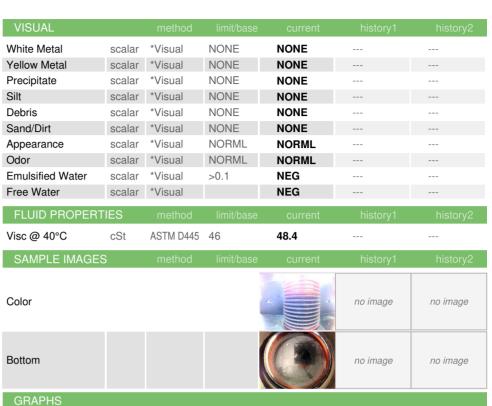


# Ferrous Alloys

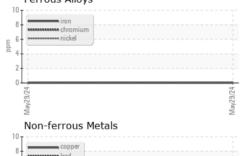

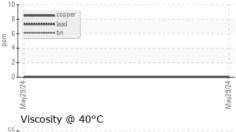

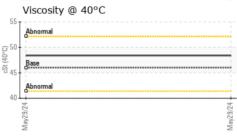

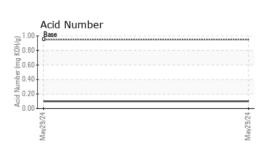





Certificate 12367

Laboratory Sample No.

Lab Number : 06195968

Test Package : IND 2

: UCH06195968

Unique Number : 11058091

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 30 May 2024 **Tested** Diagnosed

: 02 Jun 2024 : 02 Jun 2024 - Don Baldridge

CARLSTADT, NJ US 07072 Contact: ELVIN DIAZ ediaz@airmaticcompressor.com;canastasio@wearcheckusa.com

**AIRMATIC COMPRESSOR SYSTEMS** 

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: (800)864-7621 F: (201)342-6241

700 WASHINGTON AVE

Report Id: UCAIRCAR [WUSCAR] 06195968 (Generated: 06/02/2024 12:51:59) Rev: 1

Contact/Location: ELVIN DIAZ - UCAIRCAR